





### **DESCRIPTION OF RESPONDENTS:**

This matter came to the attention of CPSC through a referral from a States Medical Examiner's Office. An on-site of the incident location was not done because the family moved from the home; however, the father of the victim was interviewed by telephone on August 10, 2010. The medical examiner's office provided the autopsy and accompanying investigative report. Additionally, the medical examiner's office allowed this investigator to photograph the products. The investigative report from the State Troopers was requested and received. In an attempt to locate an address for the bumper pad manufacturer, this investigator spoke with the owner of the business.

### **SUMMARY OF FINDINGS:**

The seven-week old male victim lived with his two-year-old sister and 27-year-old mother and father in a small city in the Pacific Northwest, which is approximately 50 miles north of the state's largest city. According to the father of the victim and the medical examiner's office, the family lived in an upscale neighborhood.

According to the family, prior to the birth of their son, friends of the mother held a baby shower and many of the gifts were received including the bumper pad and positioner. When asked where they were purchased, the father was pretty comfortable indicating a specific large chain retailer although he stated some of the items were probably ordered on-line.

When asked about the positioner, the father described it as a baby product they used with their daughter when she was small. He stated that the idea of the positioner is to lay the baby within the triangles and there is a slight incline. There was also a flap so that the position of the baby would change every night. He explained this as to prevent the baby from getting a flat head. It is also used to keep the baby immobilized and prevent him from rolling over.

The father stated that the victim was born on February 17, 2010 and was healthy. Approximately two weeks before the victim's death, the child had a viral fever which he was hospitalized and placed on an antibiotic. When asked, the father stated the victim was hospitalized from Friday through Sunday. He further stated that his son's fever was gone within 24 hours; however, medical personnel had problems getting a spinal tap; but, they were able to obtain good blood cultures.

This investigator inquired as to the victim's traits and habits at seven weeks and the father stated that he was not doing much except smiling and could grasp fingers. The father specifically reported that his son was not rolling over at this time frame. When asked about sleeping habits, the father reported that his son could sleep through some of the nights, but would still occasionally wake up. According to the father, his wife had one month of maternity leave and had just returned to work before the incident.

The incident occurred on April 8, 2010 when the father reported that his wife went to bed at approximately 10:00 p.m. The father stayed up with the victim and believes his son

fell asleep in his arms between 11:30 p.m. and 12:00 a.m. After his son fell asleep, the father placed him in the crib. According to the father, the positioner was in the crib and he arranged his son within this positioner with him facing to the wall which would have been the baby's left side (See Photos 1 through 3). The father then took a shower before getting into bed.



**PHOTO #1:** This photo was taken by the medical examiner's office and shows the position of the infant's crib in the bedroom. The infant was laying on his left side toward the wall.



**PHOTO #2:** Photograph taken by the medical examiner's office, shows the father's explanation of how he positioned of the baby on the left side. Note the stuffed animal and an electrical device are shown in the crib.



**PHOTO #3:** This photo was taken by the medical examiner and shows the position of the infant when he was laid down to bed for the night.

Between 6:00 and 6:15 a.m. the father woke up and was concerned because nobody in the house was awake. The victim's father walked into his room and could see his son had

rolled over the positioner and was face down in the corner of the crib. According to the father, his son's nose was between the bottom of the bumper pad and the mattress – right where it meets (See Photos 4 & 5).



**PHOTO #4:** This photo was taken by the medical examiner's office and shows the position the baby was found in the morning by the father.



**PHOTO #5:** This photo was taken by the medical examiner's office and shows another angle of the baby's position in the crib.



**PHOTO #6: This photo was taken by the medical examiner's office and shows a top view of the baby's position when found by the father.**

The father rolled his son back over and knew exactly what had happened. He stated that he immediately screamed for his wife and took his son out of the crib. The father initiated CPR on the infant and his wife took over CPR while the father called 9-1-1. According to the father, emergency services arrived and his son was declared dead and not transported to the nearest medical facility.

When asked about his weight and height, the father reported that his son was approximately eight to ten pounds (8 – 10) and wasn't sure on his exact height, but knew that he was less than 20 inches when he was born. The father wasn't absolutely sure, but believes that his son had just started his immunizations.

This investigator inquired whether his son slept in the crib from the beginning and the father replied no. According to the father, the victim slept in a bassinet up until one to two weeks prior to the incident when they started using the crib. The father stated that his son slept in the crib at least ten times and the positioner was always used. He further stated that the nursery was right across the hall from the master bedroom.

The father reported that his son was always swaddled in a very thin receiving blanket before being placed down for the night. The father indicated that at the time of the incident, there was a comforter underneath the positioner and there was a crochet blanket in the crib, he stated no other items were in the crib at the time of the incident. The father also relayed that the victim was not taking any medications at the time of the incident.

Additionally, the father stated that his son did not have a pacifier that night. He further stated that on those occasions they gave him a pacifier, he would just spit it out.

The father told this investigator that with their daughter they used a positioner until she was crawling out. The family did not experience any problems with the daughter's positioner or bumper pad in her crib. Based on the excellent history with their daughter, they wanted to use the same setup with their son.

During the interview, the father told this investigator that the death of his son has literally changed their entire life. He explained this by stating the family was unable to stay another night in the home and ultimately had to sell their home for a substantial loss. Both the mother and father resigned from their jobs and the family relocated to another state.

In addition to selling the house, the family sold both their vehicles at a loss and almost all their possessions. The father stated that they moved from a fully furnished four bedroom, three bath home into a small apartment. The family only shipped 3200 pounds of personal items and the remaining possessions were sold in a garage sale. The father told this investigator that they basically kept only those items that weren't replaceable.

According to the father, the family went from a monthly income of \$6,000 - \$7,000 down to \$3,000. Additionally, the family no longer has a nice home and is living in an apartment which they pay approximately \$600 a month. Currently, the victim's mother is the only one working and the father has decided to go back and finish his college degree and continue on to law school.

The father said this incident has had extraordinary ramifications on the family aside from loss of income. Both the mother and father are in counseling and he said that his son's aunt, uncle and the father's mother-in-law and father-in-law have all received various forms of counseling to deal with this matter. Even the extended family suffered financial losses because of having to fly to family on short notice.

When asked by this investigator, the father stated that they have not filed any sort of lawsuit in this matter; however, they were meeting with an attorney within the next couple of weeks to make a decision. During this telephone interview, the father was asked about releasing the sample in the custody of the medical examiner's office to CPSC; however, the father stated that he wanted to keep the items in case they filed a lawsuit.

This investigator also requested the father sign a medical release so recent records could be obtained regarding his son's brief hospitalization. The form was e-mailed to the father on August 10, 2010; however, it has not been returned. On the same day, an Authorization of Name Release was also e-mailed and likewise that document was not returned. During the telephone interview, the father told this investigator that he wanted his personal information kept strictly confidential.

As stated in the beginning of this report, the death of the infant boy was reported to CPSC by the State's Medical Examiner's Office. In addition to providing the autopsy and investigator's narrative, the M.E.'s office provided a SUIDI report which is a Sudden Unexplained Infant Death Investigation. The SUIDI report was given to the M.E.'s office by the State Troopers.

The SUIDI report indicates that the father placed the victim in the crib at approximately 11:30 p.m. on April 7, 2010 and found the baby with his face against the bumper pad at 6:15 a.m. the morning of April 8, 2010. The father reported to the trooper that the baby was placed in the crib on his left side and was found on his left side with his stomach down.

The report further indicates that the temperature in the room was normal. The reading on the thermostat was 69 degrees Fahrenheit. The outside temperature on that day was 30 degrees Fahrenheit. The SUIDI also stated that near the infant's face, nose or mouth was the bumper pad and stuffed animals. The father reported to the trooper that his son's body was rigid and cool to the touch and that both parents attempted CPR.

The SUIDI report outlined medical information provided to the trooper by the victim's mother. According to the report, the infant had a history of Apnea but did not provide further detail. The SUIDI also states that the baby's weight at birth was 7 pounds, 2 ounces, and that he was 20 inches. The report indicates that the delivery was normal with no complications and the infant was not premature.

The trooper asked the parents about the child's feeding habits which the father stated that four to five ounces of Parent's Choice Formula was fed to the child just before he was put to bed and that a bottle was not placed in the crib with the child.

On September 2, 2010, the investigative report was received from the State Troopers. Included within this report, was the original SUIDI report provided to the medical examiner's office. The investigative report confirms the information contained in the SUIDI report and further states that at approximately 6:35, the victim's father went into his son's room and noticed that his son was lying on his stomach with his face between the mattress and the baby bumper of the crib. The report further stated that the father reported his son was pale and appeared lifeless. EMS arrived on the scene at approximately 7:22 a.m. and reported that the victim was in the onset of rigor and they believed he had been deceased for some time. EMS formally pronounced the victim dead at 7:31 a.m.

The trooper investigative report indicated that when additional investigators arrived to process the scene, they noticed a mark on the infant's forehead which they believe was from the compression into the bedding. Investigators noticed a small amount of dried blood in the victim's right nostril and a very small cluster of reddish brown stain on the blanket.

State troopers contacted the medical examiner's office which sent an investigator to the scene to work with the troopers. The ME investigator told the troopers that he did not believe there was any foul play and after doing a recreation of the events, left the scene with the victim's body.

The Medical's Examiner's Investigative Report indicates that two weeks prior to the child's death, he was diagnosed with Infant Asthma at the local Medical Center. Additionally, the investigative report states the child had been ill with influenza and vomiting recently.

The toxicology report of the victim's blood indicated the following results:

Carboxyhemoglobin	5.0%
Methemoglobin	10%
Sulfhemoglobin	12%

The M.E.'s office provided this investigator with a copy of the autopsy report which was signed by the Chief Medical Examiner on July 20, 2010. The report indicates that the body of the infant was that of a normally-developed, well-nourished which measured 57 centimeters in length. Under microscopic examination the medical examiner did not find any abnormalities with any organ except the lung. The report indicates the lungs had "Focal collapse (probably artifactual) with minimal interstitial mononuclear cells; no evidence of asthma."

The pathological findings and opinion by the medical examiner were reported as:

- I. Probably asphyxia**
  - a. Found prone with face wedged between bumper pad and mattress.**
  - b. Use of sleep positioner.**
  - c. Anterior lividity with pallor of nose, mouth, and forehead.**

**Opinion:**

**"The cause of death in this infant is attributed to asphyxia from the face being wedged between a crib bumper and mattress. The baby reportedly rolled over a positioner and was found in the above described position. The manner of death is accident."**

On August 12, 2010, a retailer visit was conducted at retail location for the chain retailer. The Human Resource Manager spoke with this investigator and all attempts to locate the items in the store were unsuccessful. The crib bumper pad was located on-line and determined to be part of a set that included a fitted sheet, bumper, bed skirt, and comforter. Although several variations of the positioner could be found on-line, the exact one with the appropriate dimensions could not be located.

In an attempt to locate an address for the manufacturer of the bumper pad, this investigator contacted the company listed and received a return call from the owner of the business. According to the owner, the bumper pads are made in India and the primary business location is in Houston, Texas. The firm does mainly on-line sales and does contract with the large chain retailer named by the victim's father to sell these particular crib sets.

**PRODUCT DESCRIPTION:**

- Product Type:** Positioner  
**Brand:** Sassy  
**Model Number:** 054R1  
**Manufacturer:** Sassy, Inc.  
2305 Breton Industrial Park Drive SE  
Kentwood, MI 49508  
**Retailer:** Unknown  
**Purchase Price:** Unknown

The victim was sleeping in a Sassy Sleep Positioner, model 054R1 which the father believes was purchased at Target. A search of the Target website and also with the manager at the Anchorage Target store, failed to find this exact model based on the measurements of the product. According to the father, the positioner has a tab at the top of the product which allows the parents to switch the direction the child is sleeping (See Photo #7).




**PHOTO #7:** This photo shows the incident positioner that was being used by the victim at the time of his death.

The medical examiner's office allowed this investigator to measure the positioner which indicated the following:

Length	16 inches (without tab)
Width	13 inches
Wedge	7 ½ x 3 ½ inches (curved)

The law tag for the article states the following (See Photos 8 through 10):

**“UNDER PENALTY OF LAW THIS TAG NOT TO BE REMOVED  
EXCEPT BY THE CONSUMER  
ALL NEW MATERIAL CONSISTING OF POLYURETHANE  
FOAM PAD – 90%, POLYESTER FIBER BATTING – 10%  
Reg. No. PA-27401 (HK)  
Certification is made by the manufacturer that the materials in this  
article are described in accordance with the law.  
MADE FOR:  
Sassy, Inc.  
2305 Breton Industrial Park Drive SE  
Kentwood, MI 49508 USA  
DATE OF DELIVERY:  
0709  
FINISHED SIZE: 13.00 IN X 19.00 IN X 3.25 IN  
NET WT OF FILLING MATERIAL: 2.31 OZ (0.14 LB)  
MADE IN CHINA”**

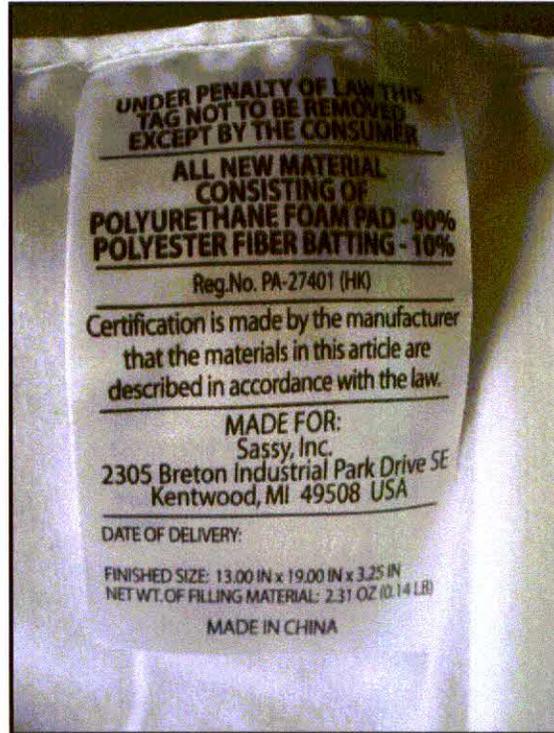

**PHOTO #8:** This photo shows the law tag for the positioner.



**PHOTO #9:** This photo shows the stamped date of delivery which says: “0709.”

The underneath law tag references the flammability requirements and states the following (See Photo #10):

**“NOTICE**

**THIS ARTICLE MEETS THE FLAMMABILITY REQUIREMENTS OF CALIFORNIA BUREAU OF HOME FURNISHINGS TECHNICAL BULLETIN 117. CARE SHOULD BE EXERCISED NEAR OPEN FLAME OR WITH BURNING CIGARETTES.**

**CAUTION:**

- **Do not use for infants under 6 lbs (2.72 KG).**
- **Once your baby starts to move around during sleep, the Sleep Positioner should no longer be used.**



**PHOTO #10: This photo shows the second law tag regarding flammability and also contains a cautionary statement.**

Underneath the law tags was the manufacturer's tag which read (See Photo #11):

**“Sassy**

**©2009 Sassy, Inc.**

**616-243-0767**


**[www.sassybaby.com](http://www.sassybaby.com)**

**Instructions for care:**

- **Machine wash separately in cold water, delicate cycle. No bleach. Drip dry. The Sleep Positioner should be dried completely after washing.**
- **Inspect for rips, tears, and openings on a regular basis. If any should appear, discontinue use and discard the product immediately.**

**Style: 054R1**

**Place of Mfg: Shenzhen City, Guangdong  
Province, China”**

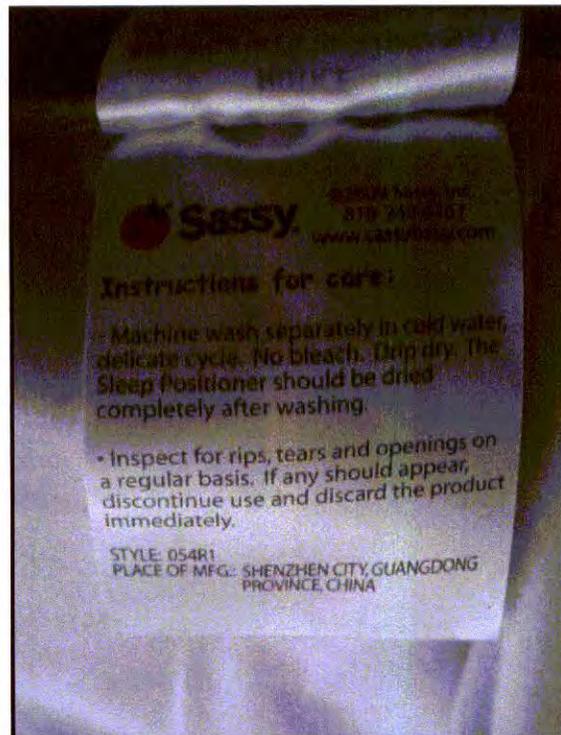

**PHOTO #11: This photo shows the manufacturer’s information to include style number and place of manufacture.**

On the bottom of the positioner is a cautionary statement which reads (See Photo #12):

**“CAUTION:**

**Once you baby begins to move around during sleep, the Sleep Positioner should no longer be used.”**



**PHOTO #12:** This photo shows the cautionary statement on the positioner.

- |                         |   |
|-------------------------|---|
| <b>2. Product Type:</b> | Bumper Pad  |
| <b>Brand:</b>           | Bacati  |
| <b>Model Number:</b>    | Aiden   |
| <b>Manufacturer:</b>    | Bacati, Inc.<br>10039 Briar Park Trail Lane<br>Houston, Texas 77064 |
| <b>Retailer:</b>        | Target<br>On-line   |
| <b>Purchase Price:</b>  | \$120 (approximately)   |

According to the father, the crib set was purchased on-line from Target in Wasilla, Alaska. A search of the Target website shows that the bedding set is called Aidan and has four pieces (See Attachment #6). In addition to the bumper pad (See Photo #13), the line comes with sheets, a bed skirt, and comforter. The Target numbers for the item are: DPCI: 242-08-3747, ASIN: B0018SXE02, Catalog #: 10874272.



**PHOTO #13:** This photo shows the bumper pad which was in the infant's crib at the time of the incident.

The bumper pad at the medical examiner's office had the following measurements:

Length: 77 ¼ inches  
Width: 9 ½ inches  
Thickness: 2 inches



**PHOTO #14:** This photo shows the manufacturer's name of the product.

The comforter that came with the set measured 34 inches by 43 inches (See Photo #15).



**PHOTO #15: This photo shows the matching comforter for the crib set and was in the crib at the time of the incident.**

In addition to the Sleep Positioner and the bumper pad, the medical examiner's office report that there was a matching comforter (See Photo #15), a light blanket (See Photo #16), two receiving blankets (See Photo #23), and a handmade crochet blanket (See Photo #24).

The blanket that was in the crib measured 28 inches by 36 inches (See Photo #16).



**PHOTO #16:** This photo shows the blanket that was in the crib at the time.



**PHOTO #17:** This photo shows the emblem on the front of the blanket.


According to the label for the blanket, it was manufactured by Lambs & Ivy and the tag attached read (See Photo #18):

**“Lambs & Ivy  
PRODUCTS FOR BABY**

**MADE IN / HECHO IN CHINA  
CARE AND CONTENTS  
ON REVERSE  
CUIDADO Y CONTENIDO  
AL REVERSO  
RN 83285”**



**PHOTO #18: This photo shows the front label of the Little Prince blanket that was used.**

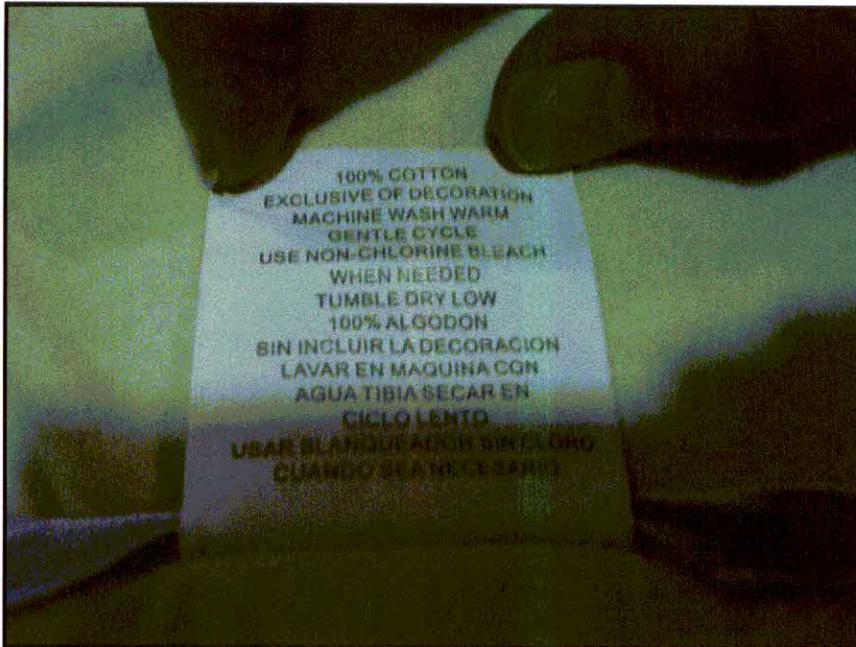

**PHOTO #19:** This photo shows the care instructions for the blanket.



**PHOTO #20:** This photo shows the crochet blanket, two thin receiving blankets, and the clothing the infant was wearing.



**PHOTO #21: This photo shows the baby's sleeper that he was wearing at the time of the incident.**

The label for the clothing indicates that the product is a Gerber sleeper and the reads (See Photo #22):


**“Gerber  
NB 5-8 LBS.  
100% COTTON  
EXCLUSIVE OF DECORATION  
MADE IN INDIA”**



**PHOTO #22:** This photo shows the label for the infant's article of clothing he was wearing at the time.


In addition to the above articles, the medical examiner's office and father confirmed that there was a crocheted blanket and two light receiving blankets in the crib. The crocheted blanket appears to be handmade and there is not identifying markings on the product (See Photo #24). The receiving blankets were covering the sleep positioner in the crib (See Photos 2 through 6); however, the blankets did not have any identifying information and their manufacturer could not be determined (See Photo #23).

The two receiving blankets each measured 28 ½ by 37 ¾ inches (Photo #23).

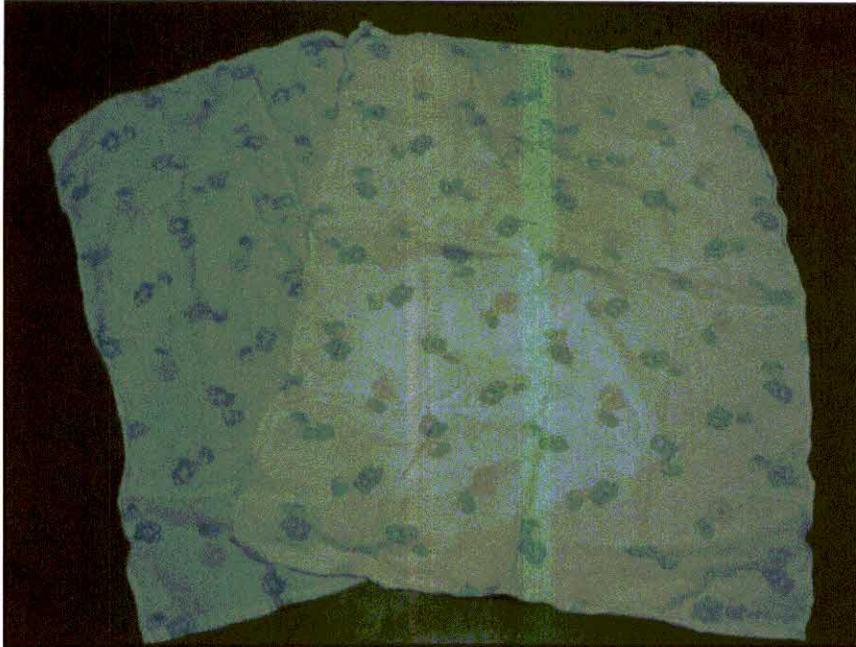

**PHOTO #23:** This photo shows the two receiving blankets which were in the crib over the sleep positioner. Information about who manufactured the items could not be determined.

The crocheted blanket measured 29 by 28 ½ inches (See Photo #24).

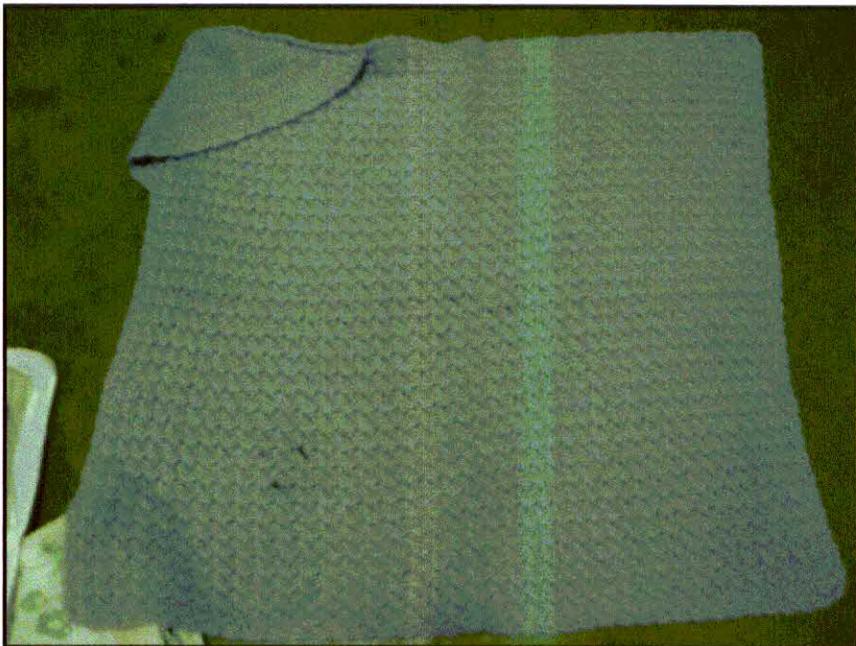

**PHOTO #24:** This photo shows the handmade crocheted blanket that was also in the crib.

The last products identified in this report are the mattress and crib the infant was sleeping in at the time of the incident. The specifications for either the mattress or crib are unknown because neither was taken into custody at the time by the medical examiner's office (See Photo #25).



**PHOTO #25:** This photo was taken by the medical examiner's office and shows the crib that was in the infant's room at the time of the incident.

**SAMPLE COLLECTION:**

Although the medical examiner's office had the items from the crib including the bumper pad and positioner, they stated the family had to provide authorization to release the items to CPSC. This investigator talked with the father of the victim and he declined to release the items; therefore, no sample was collected.

**ATTACHMENTS:**

1. Identity of Respondents
2. Authorization of Name Release (NO)
3. State of Alaska Medical Examiner's Autopsy
4. State of Alaska Medical Examiner's Investigator Narrative
5. State of Alaska Trooper Investigative Report & SUIDI Report
6. Target Website Information on Bumper Pad
7. Notice of Inspection
8. Photographs (embedded within narrative)

**IDENTITY OF RESPONDENTS:**

1. Kyle Maxwell  
Victim's Father  
93 Lapis Lane #1  
Fayetteville, Arkansas 72701  
907-982-4333
  
2. Laura Maxwell  
Victim's Mother  
93 Lapis Lane #1  
Fayetteville, Arkansas 72701  
907-841-7317
  
3. Steven Hoage  
Supervising Investigator  
State of Alaska  
Office of the State Medical Examiner  
5455 Dr. ML King Jr. Avenue, Suite 117  
Anchorage, Alaska 99507  
907-334-2200
  
4. Alvin Ancheta,  
Operations Administrator  
State of Alaska  
Office of the State Medical Examiner  
5455 Dr. ML King Jr. Avenue, Suite 117  
Anchorage, Alaska 99507  
907-334-2200
  
5. Dr. Katherine Raven  
Chief Medical Examiner  
State of Alaska  
Office of the State Medical Examiner  
5455 Dr. ML King Jr. Avenue, Suite 117  
Anchorage, Alaska 99507  
907-334-2200
  
6. Bethany Lyons  
HR Manager  
Target  
150 W 100<sup>th</sup> Avenue  
Anchorage, Alaska 99515

7. Deepak Wadhvani  
Owner  
Bacati Inc.  
10039 Briar Park Trail Lane  
Houston, Texas 77064  
713-466-6555  
[Deepak@bacati.com](mailto:Deepak@bacati.com)
  
8. Records Clerk  
Alaska State Troopers  
Department of Public Safety  
453 S. Valley Way  
Palmer, Alaska 99645

# U.S. Consumer Product Safety Commission

## AUTHORIZATION FOR RELEASE OF NAME

Thank you for assisting us in collecting information on a potential product safety problem. The Consumer Product Safety Commission depends on concerned people to share product safety information with us. We maintain a record of this information, and use it to assist us in identifying and resolving product safety concerns.

We routinely forward this information to manufacturers and private labelers to inform them of the involvement of their product in an accident situation. We also give the information to others requesting information about specific products. Manufacturers need the individual's name so that they can obtain additional information on the product or accident situation.

Would you please indicate on the bottom of this page whether you will allow us to disclose your name? If you request that your name remain confidential, we will of course, honor that request. After you have indicated your preference, please sign your name and date the document on the lines provided.

I request that you do not release my name. My identity is to remain confidential. **(STRICTLY CONFIDENTIAL PER CONSUMER)**

You may release my name to the manufacturer but I request that you do not release it to the general public.

You may release my name to the manufacturer and to the public.

\_\_\_\_\_**Via Telephone Interview**\_\_\_\_\_ **August 10, 2010** \_\_\_\_\_  
(Signature) (Date)
























































































Target.com  
Home Page

## Aidan 4-pc. Crib Bedding Set

4.5 stars (2 reviews)

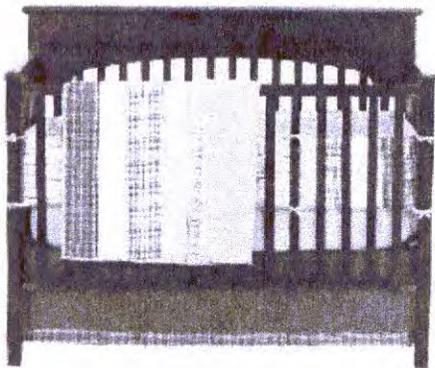

Bullseye Free Shipping  
with Qualifying \$50 Order  
This item is out of stock.

We're sorry. This item is out  
of stock.

This item can be combined with other eligible items for Bullseye Free Shipping when you spend \$50. Discount applied at Checkout. See offer details.

### Guests who viewed this item ultimately bought:



**38%** bought:  
Aidan Valance

~~\$23.99~~ Add to Cart to see low price in new window.




**22%** bought:  
Aidan Diaper Stacker

~~\$23.99~~ Add to Cart to see low price in new window.



**17%** bought:  
Tiddliwinks Vintage Varsity 3 Pc Bed Set  
4.5 stars (2)

~~\$55.99~~

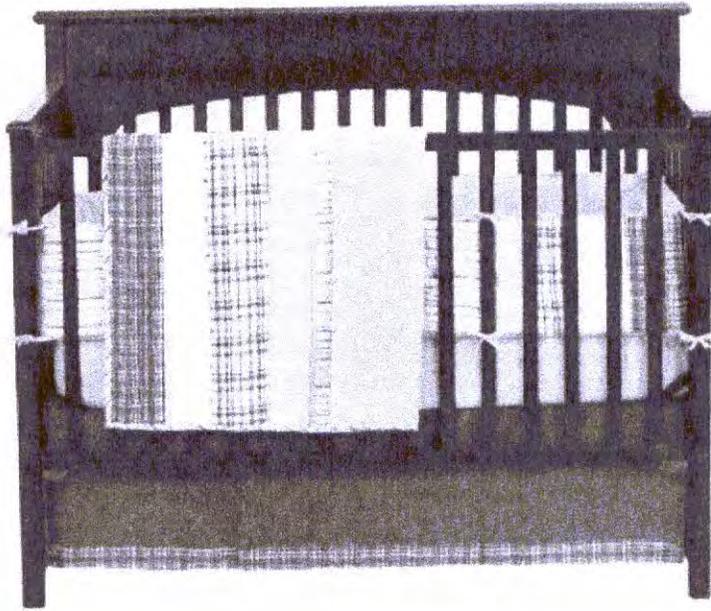

## Features

- **Includes:** Fitted Sheet, Bumper, Bed Skirt, Sheet, Quilt/Coverlet, Comforter
- **Features:** Quilted Design
- **Number of Pieces:** 4
- **Material:** Cotton
- **Care and Cleaning:** Machine Wash

## Additional Information

Product, Sizing & Measuring Guides

**DPCI:** 242-08-3747

**ASIN:** B0018SXEO2

**Catalog #:** 10874272

Item can not be gift wrapped.

Imported

## Shipping & Policies

- You may return this item to any Target store.
- Shipping & Delivery Information
- Estimated Ship Dimensions : 24 inches length x 12 inches width x 8 inches height
- Estimated Ship Weight: 7.00 pounds.
- This item can only be shipped to the 50 states. We regret it cannot be shipped to APO/FPO, or Puerto Rico.
- We regret that this item cannot be shipped to PO Boxes.

## Guest Reviews

**Average rating:**

**Sort By** Most Helpful First

1-2 (of 2 Reviews)

[Write your own Review >](#)

### Most Helpful Review

1 out of 1 people found the following review helpful:

**LOVE THIS SET!** July 21, 2010

Reviewer: **Jaks** (Nebraska) [See all my reviews >](#)

I received this bedding set as a gift and I love it! I just got it all put together this morning and it fits wonderfully. The colors are beautiful as well. I have no regrets for registering for this bedding set!!!!

Was this review helpful to you? [Yes](#) [No](#)

4 stars

**JUST WHAT I WAS LOOKING FOR** August 19, 2010

Reviewer: [janalee23](#) [See all my reviews >](#)

I looked high and low for an affordable crib set that did not have "characters" but would coordinate with my denim and red themed nursery. This set perfectly complements the room with all the "classic" toys and decorations.

The reason I gave it four stars is because the crib skirt has a hard time staying in place.

Was this review helpful to you? [Yes](#) [No](#)

Related terms: [bacati crib bedding set](#)

U.S. CONSUMER PRODUCT SAFETY COMMISSION	
NOTICE OF INSPECTION	
1. DATE 8/12/10	3. FROM (Area Office and Address) Houston, Office PO Box 22 Baytown TX 77613
2. TIME A.M. <u>1:30</u> P.M.	
4. TO	A. NAME AND TITLE OF INDIVIDUAL Bellaury Lyons, HR Manager
	B. FIRM NAME Target
	C. NUMBER AND STREET ADDRESS 150 W 100th
	C. CITY, STATE, AND ZIP CODE Atchafalaya, Alaska 99515
Notice of Inspection is hereby given pursuant to: <ul style="list-style-type: none"><li>• Section 5(a) of the Flammable Fabrics Act (15 U.S.C. § 1194(a));</li><li>• Sections 6(a), 9, and 10 of the Federal Trade Commission Act (15 U.S.C. §§ 46(a), 49, and 50);</li><li>• Sections 16, 19, and 27 of the Consumer Product Safety Act (15 U.S.C. §§ 2065, 2068, and 2076)</li><li>• Sections 301(e) and (f) and Section 704(a) of the Federal Food, Drug, and Cosmetic Act (21 U.S.C. §§ 331(e) and (f) and 374(a)) [Authority for inspections in connection with the Poison Prevention Packaging Act of 1970 (15 U.S.C. § 1471 <i>et seq.</i>); and/or</li><li>• Sections 4(e), 11(b), and 12 of the Federal Hazardous Substances Act as Amended (15 U.S.C. §§ 1263(c), 1270(b), and 1271).</li></ul>	
Refer to the back of this form for pertinent statutory language.	
5. PURPOSES OF INSPECTION AND NATURE OF INFORMATION TO BE OBTAINED AND/OR COPIED The purpose of this inspection is to obtain information; to review and obtain copies of items including, but not limited to, records (including electronic records), reports, books, documents, and labeling; and to obtain samples, in order to enforce or determine compliance with the Acts administered by the Consumer Product Safety Commission.	
6. FREEDOM OF INFORMATION REQUIREMENTS Those from whom information is requested should state whether any of the information submitted is believed to contain or relate to a trade secret or other matter which should be considered by the Commission to be confidential and whether any of the information is believed to be entitled to exemption from disclosure by the Commission under the provisions of the Freedom of Information Act (5 U.S.C. § 552). Any statement asserting this claim of confidentiality must be in writing, and any request for exemption of the information from disclosure must be made in accordance with the Commission's Freedom of Information Act regulations, 16 CFR Part 1015.	
7. SIGNATURE (Authorized CPSC Official) 