

# FURNACE CO EMISSIONS UNDER NORMAL AND COMPROMISED VENT CONDITIONS

# FURNACE #3 - MID-EFFICIENCY INDUCED DRAFT

October 2000

Prepared by Christopher J. Brown Ronald A. Jordan David R. Tucholski Directorate for Laboratory Sciences

The United States Consumer Product Safety Commission Washington, D.C. 20207

1.	INTRODUCTION	1
2.	TEST EQUIPMENT AND SETUP	1
a	Furnace	1
b	. Test Chamber and Furnace Closet	2
c.	. Vent Blockage Device and Vent Disconnect	3
d	. Measuring Equipment	4
	i) Furnace Operating Parameters	4
	ii) Gas Sampling Systems	4
	iii) Air Exchange Rate	5
	iv) Room Temperature, Pressure, and Relative Humidity	5
	v) Natural Gas	5
	vi) Data Acquisition System	6
3.	TEST METHODS AND PROCEDURES	6
a	Furnace Installation	6
b	. Furnace Input Rate	6
c.	Test Matrix	7
d	. Test Procedures	7
4.	DATA REDUCTION	8
a	Equilibrium Determination	8
b	. Air Exchange Rate	8
c.	Emission Rate	8
d	. CO Air-Free	9
5.	RESULTS AND DISCUSSION	9
a	. Baseline Tests (Normal Vent)	9
b	Blocked Vent Tests	9
	i) Degree of Blockage	. 10
	ii) Location of Vent Blockage	. 10
	iii) Input Rate	10
	iv) Cycling	10

c. Disconnected Vent Tests	10
i) Observation	10
ii) Location of Vent Disconnect	12
iii) Input Rate	12
iv) Cycling	12
v) Size of Disconnect	13
d. Reduced Supply Voltage	13
6. CONCLUSIONS	14
ACKNOWLEDGMENTS	14
REFERENCES	15
APPENDIX A: FURNACE SPECIFICATIONS AND SETUP	16
APPENDIX B: CHAMBER AND FURNACE CLOSET DESCRIPTION	19
APPENDIX C: MEASUREMENT OF FURNACE OPERATING PARAMETERS	21
APPENDIX D: GAS SAMPLING SYSTEM	23
APPENDIX E: FURNACE TEST MATRIX	25
APPENDIX F: DERIVATION OF AIR EXCHANGE RATE AND EMISSION RATE	27
APPENDIX G. TEST DATA RESULTS	31

# **EXECUTIVE SUMMARY**

CPSC began a test program in 1999 to evaluate the carbon monoxide (CO) exposure hazard posed to consumers when a furnace vent pipe is blocked or disconnected. This report describes only the test results of a mid-efficiency induced draft furnace (Furnace #3) and does not address any associated health affects.

Tests were conducted in an environmentally controlled chamber with the furnace installed inside a closet located within the chamber. The chamber provided a well-mixed environment in which to measure the CO concentration and also allowed for the air exchange rate to be controlled. For each test, the CO concentration and air exchange rate in the chamber were measured. The CO emission rate from the furnace was then calculated using a simple mass balance model.

Three variables were investigated to determine how each affected the CO emissions from the furnace: the condition of the vent pipe, the input rate of the furnace, and the operating mode of the furnace. Tests were conducted with the vent pipe intact, partially or totally blocked, or totally disconnected. The input rate of the furnace was adjusted to its manufacturer's specified rate or to overfire conditions. The furnace was also operated continuously or cycled on and off.

The following is a summary of the test results:

- With a normal vent pipe (no blockage or disconnect), the average steady-state concentration of CO in the chamber was negligible (0 ppm).
- The furnace, as received, overfired by approximately 8 percent (119,000 Btu/hr versus 110,000 Btu/hr).
- During blocked vent tests, the maximum vent blockage that the furnace would continue to operate at was 47 percent when the vent was blocked midway between the furnace and the vent outlet. At a vent blockage of 47 percent, the CO in the chamber was negligible (0 ppm).
- The location of the vent blockage did not appear to affect the operation of the furnace, since the furnace shut off when the vent was completely blocked at either the vent outlet or midway between the furnace and the vent outlet.
- During disconnected vent tests, the furnace cycled off and on when the furnace was set to operate continuously or at times other than the specified cycle rate. It appears that several of the flames were lifting off the burners, to the point of extinction, and the furnace would shut off when the flame was no longer sensed by the flame sensor. Flame lifting was most likely caused by the contamination of the combustion air with the flue gases being exhausted from the disconnected vent pipe. The furnace turned back on once a flame was sensed, generally after two to three automatic ignition attempts.
- During disconnected vent tests, the average steady-state CO concentration in the chamber reached a maximum of 35 ppm at the manufacturer's specified input rate of 110,000 Btu/hr. Under severe operating conditions (133,000 Btu/hr and continuous operation), the average steady-state CO concentration in the chamber reached a maximum of 51 ppm.
- When the supply voltage to the furnace was reduced to 85 percent of its normal value, the test results were similar to those obtained with the furnace operating at its normal supply voltage.

# 1. INTRODUCTION

CPSC began a test program in 1999 to evaluate the carbon monoxide (CO) exposure hazard posed to consumers when a furnace vent pipe is blocked or disconnected. This test program is part of CPSC's effort to reduce deaths and injuries related to carbon monoxide poisoning. The test program consists of testing several different furnaces under controlled conditions and measuring the amount of CO that accumulates in a room when the vent pipe is partially blocked, totally blocked, or disconnected. The test results will be used to model indoor air concentrations and assess health effects. These modeling results will then be used to support current and potential recommendations to the ANSI/CGA Z21.47 Gas Fired Central Furnace subcommittee. For mid-efficiency induced draft furnaces, section 2.22 of the ANSI Z21.47 standard (1998) requires that the CO present in an air-free sample of flue gas cannot exceed 400 ppm (0.04 percent) when the flue outlet is partially or totally blocked. The ANSI standard does not require the furnace to shut off under any blocked vent conditions and does not address the issue of disconnected vent pipes.

This report describes the test results for a mid-efficiency induced draft furnace (Furnace #3). Tests were conducted in an environmentally controlled chamber with the furnace installed inside a closet located within the chamber. The chamber provided a well-mixed environment in which to measure the CO concentration and also allowed for the air exchange rate to be controlled. The furnace was operated at conditions specified by the ANSI Z21.47 standard (1998) and those that could occur in actual use. For all tests, the CO concentration in the chamber and closet were measured as well as the air exchange rate in the chamber. The CO emission rate from the furnace was then calculated using the equilibrium CO concentration, the air exchange rate, and a simple mass balance model.

# 2. TEST EQUIPMENT AND SETUP

#### a. Furnace

Tests were conducted using an induced draft furnace (Furnace #3). Furnace #3 is a noncondensing, mid-efficiency gas furnace with an Annualized Fuel Utilization Efficiency of 78%. This furnace was shipped from the manufacturer preset for use with natural gas and with an energy input rate of 110,000 Btu/hr. This furnace is AGA certified (ANSI Z21.47a-CAN/CGA-2.3a 1995) as a Category I and for operation in a one-pipe vent (exhaust vent pipe) installation. The unit is configured for upflow operation (i.e., the circulation air blower is located at the bottom of the unit, blowing supply air upwards, across the heat exchanger). Figure 2.1 shows the furnace as installed for testing. Appendix A provides additional details of the furnace setup and specifications of the furnace.



Figure 2.1. Mid-Efficiency Induced Draft Test Furnace

The unit was purchased from a local heating, ventilation, and air conditioning (HVAC) dealer and installed by CPSC staff. On March 24, 1999, CPSC staff met with furnace manufacturing representatives (including a manufacturing representative for Furnace #3) and a representative from the Gas Appliance Manufacturers Association (GAMA) to obtain their input on the test protocol and setup. On March 2, 2000, representatives from the manufacturer of Furnace #3 and a representative from GAMA met with CPSC staff to witness the test setup and installation of the furnace. These representatives verified that the furnace was installed and operating properly.

Based on the design of the Furnace #3, it must comply with the draft test provisions in ANSI Z21.47 (1998) for furnaces not equipped with draft hoods (Section 2.22). Section 2.22 requires that the CO present in an air-free flue gas sample cannot exceed 400 ppm (0.04 percent) when the flue outlet is either partially or completely blocked. There are no requirements in the ANSI standard for the furnace to shut off during any blocked vent conditions. Nevertheless, this unit is equipped with a bimetal disc thermostat located near the flue outlet that will shut off the furnace if the set temperature of the disc thermostat is exceeded. The disc thermostat is located in a position such that the hot flue gases will contact it only when the vent pipe is blocked. Upon actuation, the disc thermostat must be manually reset before the furnace can be used.

# b. Test Chamber and Furnace Closet

In order to accurately model room concentrations of CO, it was necessary to measure CO emissions from the furnace in a well-mixed room while controlling the number of air changes in that room. A modified environmental test chamber was therefore used for the tests. The internal volume of the chamber was 837 cubic feet (23.70 cubic meters). The chamber was designed to provide an environment in which the air was well mixed and the temperature, pressure, and air exchange rate could be controlled. In order to prevent back drafting, the differential pressure between the chamber and the laboratory was kept near zero using a pressure control system. Appendix B describes the chamber in greater detail.

A furnace closet was erected within the chamber. The internal volume of the closet was approximately 196 cubic feet (5.55 cubic meters). The closet complied with the National Fuel Gas Code (1996) and the manufacturer's requirements for a "Confined Space" furnace installation. A well-mixed environment within the closet could not be assumed since no fans were used to promote mixing. Fans were not used in the closet in order to prevent interference with the operation of the furnace. The furnace was positioned inside the closet so that the manufacturer's specification for minimum distances to combustible surfaces was met. Appendix B describes the furnace closet in further detail.

# c. Vent Blockage Device and Vent Disconnect

An optical iris was used to create various degrees of vent blockage. Figure 2.2 illustrates the iris (black in color) located in the vent system. Different blockages were obtained by adjusting the diameter of the iris. When the iris was totally closed, blockage was 99.6 percent since a small hole was still present. For testing purposes, it was assumed that a 99.6 percent blocked vent was equivalent to a totally blocked vent. The iris was located at a vertical height of 1.25 feet (0.38 meters) and a horizontal distance of 3.42 feet (1.04 meters) from the furnace. Figure C.1 in Appendix C illustrates the general location of the iris relative to the furnace.

To investigate the affect of the blockage location on the CO emission rate from the furnace, several tests were conducted with the outlet of the vent pipe totally blocked. Blockage was created using a vent tee cap. The vent outlet was located approximately at a vertical height of 5.60 feet (1.70 meters) and at a horizontal distance of 4.00 feet (1.21 meters) from the furnace.

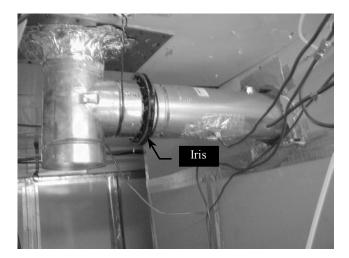


Figure 2.2. Iris Used to Create Vent Blockages

To simulate a disconnected vent pipe, the vent pipe was totally separated from a section of the vent system. The vent pipe was disconnected either inside or outside of the furnace closet. For disconnected vent tests where the vent disconnect was inside the closet, the vent pipe was separated from the furnace at the flue collar. For disconnected vent tests where the vent was disconnected outside of the closet, that is, in the chamber, the vent pipe was separated at the vent tee (Figure 2.3). The vent tee was located at a vertical height of 1.25 feet (0.381 meters) and a horizontal distance of 4.0 feet (1.22 meters) from the furnace. Figure C.1 in Appendix C illustrates the location of the flue collar and the vent tee relative to the furnace.



Figure 2.3. Disconnected Vent Pipe Outside the Furnace Closet Near the Vent Tee

- d. Measuring Equipment
- i) Furnace Operating Parameters

The operating parameters of the furnace were measured at different locations using a variety of equipment. Appendix C provides details of the equipment used and the general locations of the measurements. The natural gas flow rate to the furnace was determined using a digital mass flow meter. The gas manifold pressure was measured with a magnehelic pressure gauge. The static pressure in the vent pipe was determined using a piezo ring connected to a magnehelic pressure gauge. The piezo ring was constructed in accordance with Section 2.7 of the ANSI Z21.47 standard (1998). The static pressure between the return and supply ducts was measured with a magnehelic pressure gauge. The temperature rise across the heat exchanger was measured using two thermocouples, one in the return duct and one in the supply duct. The flue gas temperature was measured with a single thermocouple located in the center of the vent pipe. One thermocouple was used to measure the air temperature near the disc thermostat and one thermocouple was used to measure the air temperature near the inlet of the heat exchanger tubes.

ii) Gas Sampling Systems

Four sampling systems were used to measure the concentration of different chemical species at various locations. Appendix D provides details of the equipment used and a schematic illustrating the sampling systems. The first system was used to obtain CO, CO<sub>2</sub>, and O<sub>2</sub> samples from the chamber. The concentrations of CO and CO<sub>2</sub> were measured using nondispersive infrared (NDIR) gas analyzers, and O<sub>2</sub> was measured using a paramagnetic analyzer. Samples were obtained from five locations inside the chamber. The sampling lines from these five locations fed into a common mixing manifold. The mixing manifold was then connected to the gas analyzers using a single sampling line.

A second sampling system was used to obtain samples from the closet or flue gas. A threeway valve was used to switch between the closet and flue gas sampling lines. Carbon monoxide, carbon dioxide, and hydrocarbons (HC) were measured using NDIR gas analyzers and oxygen was measured using a paramagnetic analyzer. Flue gas samples were taken from a single location downstream of the flue collar. Closet air samples were taken from five locations inside the closet. The sampling lines from these five locations fed into a common mixing manifold. The mixing manifold was then connected to the three-way valve using a single sampling line. To prevent water from condensing inside the gas analyzers during the sampling of the flue gas, the water was condensed out of the sample prior to entering the analyzers. A simple heat exchange system using recirculated chilled water was used to condense the water out of the gas sample.

A third sampling system was used to obtain the concentration of CO in the return and supply ducts. A three-way valve was used to switch between the return and supply duct sample lines. The concentration of CO was measured with a NDIR gas analyzer.

A fourth sampling system was used to obtain the background concentration of CO in the laboratory. A NDIR gas analyzer was used to measure the concentration of CO. The sampling line was positioned near the inlet pipe that brought fresh air into the chamber.

## iii) Air Exchange Rate

To determine the air exchange rate in the chamber and closet, the tracer gas sulfur hexafluoride (SF<sub>6</sub>) was injected into the chamber. The flow rate of SF<sub>6</sub> was measured using a rotameter and the concentrations of SF<sub>6</sub> in the chamber and closet were measured with an electron capture gas chromatograph analyzer. To ensure that the tracer gas was evenly distributed, the gas was injected above each set of fans used with the four fin-and-tube heat exchangers. Samples were obtained using the existing sampling lines for the chamber and closet (Appendix D). To verify the number of air changes per hour (ACH) obtained with the SF<sub>6</sub> tracer gas, CO was also injected into the chamber during several tests. A mass flow controller was used for the CO injection and the NDIR analyzers for the chamber and closet were used to measure the CO concentrations.

# iv) Room Temperature, Pressure, and Relative Humidity

The temperature in the chamber was measured with four thermocouples. The thermocouples were located near each corner in the chamber. The temperature in the closet was measured with a single thermocouple located approximately midway between the floor and the ceiling. A thermocouple was also used to measure the ambient air temperature entering the chamber. The thermocouple was positioned near the inlet pipe for the fresh air supply to the chamber.

A photohelic pressure gauge was used to measure the differential pressure between the chamber and the laboratory. The pressure gauge was part of the pressure control system used to prevent the chamber from becoming over or under pressurized relative to the laboratory building in which the chamber was located.

The local pressure and temperature in the laboratory was obtained using a barometer with a built in thermometer. The relative humidity of the laboratory air was measured with a digital hygrometer.

v) Natural Gas

The furnace was fired with natural gas obtained from a city supply line. The daily average higher heating value of the natural gas was obtained from the local gas supplier (Washington Gas). In addition, the gas company supplied the daily average chemical composition of the natural gas.

# vi) Data Acquisition System

A data acquisition system was used to record the majority of the data. The system consisted of a personal computer running LABTECH<sup>®</sup> NOTEBOOK data acquisition software that recorded the data every 20 seconds. The data acquisition program recorded the raw voltage output from the various measuring devices (gas analyzers, thermocouples, pressure gauges, and flow meter) into a data file. The program converts these voltage readings directly into the appropriate units for concentration (percent or parts per million), temperature (degrees Fahrenheit), pressure (inches of water column), and flow rate (cubic feet per minute). These converted values were recorded in the data file. The only items not recorded electronically were the SF<sub>6</sub> flow rate from the rotameter, the vent pressure, the differential pressure between the chamber and laboratory, and the barometric pressure, temperature and relative humidity of the laboratory. A second computer was used with the SF<sub>6</sub> analyzer to record the SF<sub>6</sub> concentrations.

# 3. TEST METHODS AND PROCEDURES

# a. Furnace Installation

The furnace was installed according to the manufacturer's installation instructions and the National Fuel Gas Code (1996). To confirm proper furnace operation, the temperature rise across the heat exchanger and the static pressure between the return and supply ducts were checked for compliance with the manufacturer's specifications.

# b. Furnace Input Rate

The furnace input rate was set by adjusting the gas manifold pressure. This was accomplished by turning the adjustment screw of the pressure regulator clockwise to increase the pressure or counter clockwise to decrease the pressure. All input rates reported in this report are nominal. Actual input rates were within  $\pm 3$  percent of the nominal values. The input rates were calculated using an average higher heating value of 1040 Btu per cubic feet.

The input rate was initially determined before any adjustments were made to the gas manifold pressure. This input rate, termed "as received", is the rate that would occur if the furnace installer did not clock the gas flow or adjust the manifold pressure. The "as received" rate was approximately 119,000 Btu/hr, which was 8 percent over the manufacturer's specified rate of 110,000 Btu/hr. This rate is based on an average higher heating value of 1040 Btu per cubic feet. Since the installer may not clock the gas flow, a decision was made to test the furnace at its specified rate (110,000 Btu/hr) and at the "as received" rate (119,000 Btu/hr).

The original test plan included testing the furnace in accordance with the overfire provisions of ANSI Z21.47 (1998). These provisions require that the furnace input rate be adjusted to 12 percent above the manufacturer's specified rate. Since the "as received" firing rate of this furnace was 8 percent above the manufacturer's specified rate, and because staff felt it foreseeable that an installer might only adjust the manifold pressure, a decision was made to test the furnace at an input rate of 12 percent above the "as received" rate, as well as 12 percent above the manufacturer's specified rate. This resulted in firing rates of 133,000 Btu/hr and 123,000 Btu/hr, respectively. CPSC incident data demonstrates that some furnaces involved in CO exposure have, upon inspection, been found to be overfired.

# c. <u>Test Matrix</u>

Table E.1 in Appendix E shows the Furnace Test Matrix. It should be noted that not all tests listed in Table E.1 were necessarily performed. The test plan design allowed for omission of some tests within the Baseline, Blocked Vent, and Disconnected Vent tests if certain criteria were satisfied. The criteria for omission were as follows: (1) if a shutoff device or other aspect of a furnace design caused it to shutdown during any of the incremental blockage or disconnected vent conditions; or (2) if the furnace continued to operate under partial blockage or disconnect conditions, but the resultant chamber CO concentrations were negligible; or (3) if the furnace input rate, as installed, was within  $\pm 3$  percent of the manufacturer's specified input rate. If either of the first two criteria were satisfied, then tests involving lesser degrees of vent blockage or disconnect were omitted.

Each test had three main variables: the condition of the vent pipe, the input rate to the furnace, and the operating mode of the furnace. The vent pipe was intact (baseline condition), blocked, or disconnected. For blockage tests, the vent was blocked from 50 to 100 percent. Tests with the vent totally blocked were similar to the blocked vent shut off test required by ANSI Z21.47 standard (Section 2.19, 1993). For disconnected vent tests, the vent was totally separated from the vent system in the closet or in the chamber. The furnace was tested at input rates of 110,000 Btu/hr, 119,000 Btu/hr, 123,000 Btu/hr, or 133,000 Btu/hr. The furnace was operated either continuously or it was cycled on for 8 minutes and off for 2 minutes. The cycling rate was based on information obtained from the AGA booklet, "Fundamentals of Gas Appliances" (1996). The booklet states that, as a rule of thumb, the optimal cycling rate of a furnace burner is approximately six times per hour. The booklet also states that this optimal cycling rate will be maintained if the furnace is operating 20 to 80 percent of the time. Therefore, a cycle time of 8 minutes on and 2 minutes off was used.

#### d. Test Procedures

At the start of each day, the gas analyzers were calibrated according to the instructions specified by the manufacturer of the analyzer. In general, the meters were zeroed with nitrogen gas and spanned using a gas of known concentration (EPA protocol). The analyzers were also checked at mid- and low-range concentrations to verify the performance of the analyzers. To begin an actual test, the data acquisition program was started. The furnace was then started by setting the cycle timer to operate continuously or to cycle on and off. The cycle timer was used to simulate a call for heat by a thermostat. The furnace was allowed to warm up for 15 minutes in order to reach equilibrium. This 15-minute warm up is similar to many test protocols in the ANSI Z21.47 standard (1998). During this warm up period the manifold pressure was adjusted as required to attain the desired input rate. At approximately 15 minutes, the flue gas sample was obtained and the gas flow rate was recorded. If the vent was to be blocked or disconnected, staff entered the chamber and closet (if necessary) and made the appropriate changes to the vent pipe. The closet and chamber doors were closed and the SF<sub>6</sub> tracer gas injection was started. The injection of the tracer gas continued until it had reached an equilibrium concentration in the chamber (approximately one hour). By this time, the concentrations of the other the chemical species (CO, O<sub>2</sub>, and CO<sub>2</sub>) had also reached equilibrium. After reaching equilibrium, the injection of the tracer gas was stopped and the tracer gas decay was monitored. The test was complete once the concentration of the SF<sub>6</sub> tracer gas was less than 10 percent of the SF<sub>6</sub> analyzer's full-scale value. The data acquisition program and cycle timer were then stopped and

the chamber and closet were allowed to air out before beginning the next test. As a back up to the electronic data, the concentration data were recorded manually at various times during the test. The times at which the three-way valves were switched to toggle between the return and supply duct samples and between the closet and flue samples were also recorded manually.

# 4. DATA REDUCTION

# a. Equilibrium Determination

All data from the data acquisition program were imported into a Microsoft<sup>®</sup> Excel spreadsheet. The SF<sub>6</sub> concentration data were also imported into the same spreadsheet. The concentrations of CO and  $O_2$  in the chamber and closet were then plotted versus time in order to determine the equilibrium period. Once the equilibrium period was established, the average values for all data were calculated during this time interval. For cycling tests, the gas flow rate and the manifold pressure were averaged only during the on time of the cycle. Once the average values were obtained, the CO concentrations were corrected for any background CO present in the laboratory during the equilibrium period and also for any meter offset present at the start of the test. Unless otherwise noted, all reported concentrations are average steady-state values.

## b. Air Exchange Rate

The number of air changes per hour (ACH) for the chamber was estimated from the  $SF_6$  equilibrium concentration data in the chamber. The ACH was calculated based on the assumption that the chamber can be modeled as a one-zone system. In the one-zone model, the closet is treated as a non-participating volume. Thus, the actual chamber volume is the total internal volume of the chamber less the volume of the closet and any additional equipment (return duct, vent pipe, etc.) in the chamber. The net volume is 632 cubic feet (17.9 cubic meters). Appendix F provides a derivation of the following equation used to estimate the ACH in the chamber:

$$ACH = \left[\frac{S_{inj}}{C_{eq}V}\right]$$
[4.1]

where,

ACH = number of air changes per hour in the chamber, 1/hr

 $S_{inj}$  = injection rate of SF<sub>6</sub>, cc/hr

 $C_{eq}$  = equilibrium concentration of SF<sub>6</sub> in chamber, 0.001 cc/m<sup>3</sup> or ppb

V = volume of chamber less volume of closet and any additional equipment,  $m^3$ 

# c. Emission Rate

The CO emission rate from the furnace was estimated using the CO equilibrium concentration data in the chamber. The emission rate was calculated based on the assumption that the chamber can be modeled as a one-zone system and that the emission source is the combined closet and furnace. The derivation of the emission rate is similar to the derivation of the ACH described in Appendix F. The CO emission rate is then calculated using the following equation:

$$E_{CO} = C_{CO_{an}} ACH V$$
[4.2]

where,

 $E_{CO} = CO$  emission rate, cc/hr

 $C_{COeq}$  = equilibrium concentration of CO in the chamber, cc/m<sup>3</sup> or ppm

ACH = air exchange rate in the chamber, air changes per hour

V = volume of chamber less volume of closet and any additional equipment, m<sup>3</sup>

#### d. CO Air-Free

The ANSI Z21.47 standard (1998) sets limits on the amount of CO that may be present in the flue gas. These CO concentrations are specified as "air free", which is a calculated value to remove excess air from the measured value. Air-free concentrations of CO in the flue gas were calculated using the following equation, which was obtained from the AGA booklet, "Fundamentals of Gas Combustion" (1996):

$$CO_{airfree} = CO\left[\frac{CO_{2,ultimate}}{CO_2}\right]$$

where,

CO<sub>air free</sub> = air-free sample of CO, ppm

CO = measured CO in flue gas, ppm

CO<sub>2, ultimate</sub> = ultimate CO<sub>2</sub>; the amount of CO<sub>2</sub> produced at stoichiometric conditions, %

 $CO_2$ , = measured  $CO_2$  in flue gas, %

Based on the information provided by local gas supplier (Washington Gas), the average ultimate  $CO_2$  was 11.9 percent.

# 5. RESULTS AND DISCUSSION

# a. Baseline Tests (Uncompromised Vent)

Tests were conducted with an uncompromised vent pipe (no blockage or disconnect) to establish the baseline operating conditions of the furnace at different input rates, and with the furnace cycling or operating continuously. For all test conditions, the average steady-state concentration of CO in the chamber was negligible (0 ppm) as illustrated in Table G.1 (Appendix G). The air exchange rate in the chamber varied from 10.0 to 11.8 air changes per hour.

# b. Blocked Vent Tests

Four variables were considered during the blocked vent tests: (1) the degree of vent blockage, (2) the location of vent blockage, (3) the input rate of the furnace, and (4) the operational mode of furnace (continuous or cycling). For all blocked vent tests, the air exchange rate varied from 10.7 to 11.2 air changes per hour. Table G.2 (Appendix G) provides a list of the data. The following is a summary of the trends observed for each test variable.

# i) Degree of Blockage

The maximum vent blockage that the furnace would continue to operate at was 47 percent when the vent was blocked midway between the furnace and the vent outlet. Above 47 percent, the furnace shut off within 1 to 3 minutes of being blocked. Each time the furnace shut off, the disc thermostat near the flue outlet had to be manually reset before the furnace would operate. As Table G.2 in Appendix G illustrates, the average steady-state concentration of CO in the chamber was zero for all blocked vent tests.

# ii) Location of Vent Blockage

Tests were performed with the vent pipe completely blocked at the vent outlet in addition to the optical iris (approximately midway between the furnace and vent outlet) to investigate whether the blockage location affected the performance of the furnace. The furnace shut off within 1 to 3 minutes after the vent pipe was completely blocked at either location.

## iii) Input Rate

The concentration of CO in the chamber was negligible for all input rates tested (Table G.2, Appendix G). At the maximum input rate of 133,000 Btu/hr and with the vent blocked 47 percent, the average steady-state CO concentration in the chamber was 0 ppm and the air-free concentration of CO in the flue gas was 35 ppm.

## iv) Cycling

Since the concentration of CO in the chamber was negligible when the furnace operated continuously, no tests were performed with the furnace cycling on and off.

#### c. Disconnected Vent Tests

Four variables were considered during the disconnected vent tests: (1) the location at which the vent pipe was disconnected, (2) the input rate of the furnace, (3) the operational mode of the furnace (continuous or cycling), and (4) the degree of disconnect. For all disconnected vent tests, the air exchange rate in the chamber ranged from 10.5 to 12.5 air changes per hour. Table G.3 located in Appendix G provides a complete list of the data.

Before discussing the trends for each test variable, it is necessary to first discuss an observation made during the disconnected vent tests, since it affected the overall performance of the furnace.

#### i) Observation

During the disconnected vent tests, it was noticed that the furnace would begin to cycle off and on after the vent pipe had been disconnected for at least 10 minutes. This would occur when the furnace was set to operate continuously or at times other than the specified cycle rate. The furnace would initially shut off for approximately 2 minutes, after which the furnace ignition was attempted automatically by the furnace. After 10 seconds, the furnace shut off, which indicated that a flame had not been sensed. This sequence was repeated two to three more times before a flame was finally sensed and the furnace remained on. The furnace continued to operate for approximately 7 to 13 minutes before the furnace shut off again and the entire cycling sequence was repeated.

In order to observe the burner flames, the furnace was operated with its front panel removed and with the door to the furnace closet open. After approximately 10 to 15 minutes of

operation, it was observed that several of the flames appeared to lift off the burners. Lifting can occur when the air used for combustion becomes contaminated with the combustion products. Several times, one or two of the flames went out, but came back on before the furnace finally shut off. This lifting effect was most noticeable for the burner that contained the flame sensor. The flame sensor was a metal rod that contacted the flame and shut off the gas flow to the furnace when the flame was not sensed. If a flame was not sensed after a total of four ignition attempts, the furnace entered a "lockout" mode. However, the furnace never entered a "lockout" mode during any of the tests.

Representatives from the company that manufactured Furnace #3 observed this cycling issue during a visit to the CPSC laboratory on March 2, 2000. They suggested that the inducer fan might be interfering with the operation of the burners, since the inducer fan motor was located above the burners. To eliminate this interference, they suggested installing a metal shield between the burners and the inducer fan. However, when the shield was installed, the furnace continued to cycle.

Instead of interference between the inducer fan and burners, it was thought that this loss of flame and resulting furnace cycling might be caused by a reduction of oxygen inside the furnace closet, thereby affecting the operation of the burners. The oxygen inside the closet decreased as the air became contaminated with the combustion products being exhausted from the disconnected vent pipe. Table 5.1 lists the oxygen concentration inside the furnace closet at the time the furnace cycled off and then turned back on.

Location of Vent	Input Rate <sup>1</sup>	O <sub>2</sub> Concentration in the Closet (%)					
Disconnect	(Btu/hr)	Furnace Shut Off	Furnace Turned On				
Inside Closet	110,000	17.4 to 17.6	19.3 to 19.6				
Inside Closet	119,000	17.1 to 17.5	18.9 to 19.6				
Inside Closet	123,000	17.5 to 17.6	19.8 to 20.2				
Inside Closet	133,000	17.1 to 17.3	19.6 to 20.0				
Outside Closet	110,000	18.6	19.2 to 19.5				
Outside Closet	119,000	18.2 to 18.3	19.1 to 19.4				
Outside Closet	123,000	18.6 to 18.8	19.6 to 19.7				
Outside Closet	133,000	18.7 to 19.0	19.6 to 19.7				

TABLE 5.1. OXYGEN CONCENTRATION INSIDE THE FURNACECLOSET FOR DIFFERENT TEST CONDITIONS

1. Actual input rates are  $\pm$  3 percent of the stated values.

When the vent pipe was disconnected inside the closet, the furnace turned off at an oxygen level between 17 to 18 percent. When the vent pipe was disconnected outside the closet, the furnace turned off at an oxygen level between 18 to 19 percent. The difference in oxygen concentrations at which the furnace turned off at was most likely due to several experimental factors, which included the location of the sampling ports inside the closet, the degree of mixing between the combustion products and fresh air, and the response time of the  $O_2$  analyzer. The furnace turned back on once the oxygen concentration was between 19 to 20

percent. Additional testing would be required to determine the exact cause for the loss of flame and the resulting furnace cycling.

ii) Location of Vent Disconnect

Tests were performed with the vent pipe totally disconnected inside or outside of the furnace closet. As the data in Table G.3 (Appendix G) illustrates, there was generally no difference between the CO concentration in the chamber when the vent was disconnected inside the furnace closet as compared to outside the closet.

#### iii) Input Rate

As mentioned in the "Test Methods and Procedures" section, tests were performed at input rates of 110,000 Btu/hr, 117,000 Btu, 123,000 Btu/hr, and 133,000 Btu/hr. Figure 5.1 illustrates how the average steady-state CO concentration in the chamber varied as the furnace input rate increased. Figure 5.1 plots the data for Furnace #3 operating continuously with the vent disconnected inside the closet. At the manufactures specified input rate of 110,000 Btu/hr, the concentration of CO in the chamber was 35 ppm and the resulting CO emission rate was 7,360 cc/hr. As the input rate increased, the CO concentration in the chamber slightly decreased before increasing to a maximum of 51 ppm at 133,000 Btu/hr. The resulting CO emission rate at 51 ppm was 10,816 cc/hr. The shape of the curve was most likely influenced by the fact that the furnace cycled off and on, as previously discussed above in the "Observation" section.

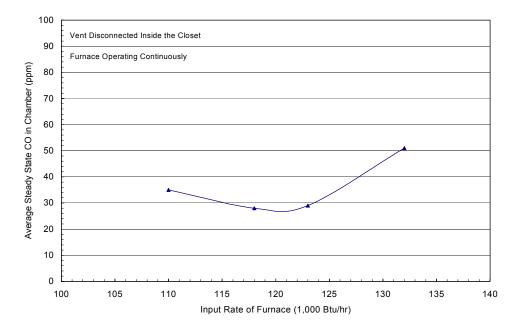


Figure 5.1. Concentration of CO in the Chamber as a Function of the Input Rate for Furnace #3

#### iv) Cycling

Tests were conducted with the furnace operating continuously or cycling at a rate of 8 minutes on and 2 minutes off. Figure 5.2 illustrates how the CO in the chamber varied with time as the furnace operated continuously and was cycled on and off. Figure 5.2 plots the

data for Furnace #3 operating at an input rate of 110,000 Btu/hr and with the vent pipe disconnected in the closet. As previously discussed above in the "Observation" section, the furnace cycled on and off when the furnace was set to operate continuously or at times other than the specified cycle rate. The average steady-state concentration of CO in the chamber was approximately 1.1 to 1.7 times higher when the furnace operated continuously compared to when the furnace was cycled on for 8 minutes and off for 2 minutes.

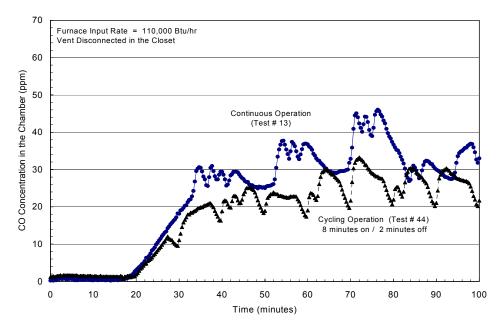


Figure 5.2. Comparison of CO in the Chamber for Furnace #3 as it was Cycled or Operated Continuously

v) Size of Disconnect

To determine what affect the size of the gap created by the disconnected pipe had on the amount of CO present in the chamber, a test was conducted with one section of vent pipe separated approximately 1.2 inches from the other section. Although separated, the vent pipes were in-line with each other. The separation occurred outside of the furnace closet. At 133,000 Btu/hr, the concentration of CO in the chamber was 0 ppm. Since no CO was observed inside the chamber at the maximum input rate tested, no additional tests were conducted.

d. <u>Reduced Supply Voltage</u>

For induced draft furnaces, ANSI Z21.47 (1998) requires a 15 percent reduction in supply voltage to the furnace during certain tests. Therefore, several tests were conducted with the supply voltage reduced from its normal value of 120 volts to 102 volts, or 85 percent of its normal value. Since investigating the affects of a reduced supply voltage was not part of the original test plan, only three tests were performed: two blockage tests and one disconnected vent test. Similar results were obtained for the tests where the furnace supply voltage was reduced as compared to tests where the supply voltage was normal. In addition, the furnace

continued to cycle off and on when the vent was disconnected and the furnace was set to operate continuously.

# 6. CONCLUSIONS

The following is a summary of the test results:

- With a normal vent pipe (no blockage or disconnect), the average steady-state concentration of CO in the chamber was negligible (0 ppm).
- The furnace, as received, overfired by approximately 8 percent (119,000 Btu/hr versus 110,000 Btu/hr).
- During blocked vent tests, the maximum vent blockage that the furnace would continue to operate at was 47 percent when the vent was blocked midway between the furnace and the vent outlet. At a vent blockage of 47 percent, the CO in the chamber was negligible (0 ppm).
- The location of the vent blockage did not appear to affect the operation of the furnace, since the furnace shut off when the vent was completely blocked at either the vent outlet or midway between the furnace and the vent outlet.
- During disconnected vent tests, the furnace cycled off and on when the furnace was set to operate continuously or at times other than the specified cycle rate. It appears that several of the flames were lifting off the burners, to the point of extinction, and the furnace would shut off when the flame was no longer sensed by the flame sensor. Flame lifting was most likely caused by the contamination of the combustion air with the flues gas being exhausted from the disconnected vent pipe. The furnace turned back on once a flame was sensed, generally after two to three automatic ignition attempts.
- During disconnected vent tests, the average steady-state CO concentration in the chamber reached a maximum of 35 ppm at the manufacturer's specified input rate of 110,000 Btu/hr. Under severe operating conditions (133,000 Btu/hr and continuous operation), the average steady-state CO concentration in the chamber reached a maximum of 51 ppm.
- When the supply voltage to the furnace was reduced to 85 percent of its normal value, the test results were similar to those obtained with the furnace operating at its normal supply voltage.

# ACKNOWLEDGMENTS

Editors: Andrew Stadnik, Warren Porter, and James Hyatt

Design and Construction of Test Chamber: Mark Eilbert, Han Lim, and Perry Sharpless

General Support: Paula Simon, Dean LaRue, Dwayne Davis, Thomas Hardison, Shing-Bong Chen, and Janet Buyer

#### REFERENCES

American National Standard/National Standard of Canada for Gas-Fired Central Furnaces, ANSI Standard No. Z21.47-1998, American Gas Association, New York, NY (1998).

Application of Tracer Gas Analysis to Industrial Hygiene Investigations, Grot, R. and Lagus, P., Lagus Applied Technology, Inc. (1991).

*Fundamentals of Gas Appliances, Revised*, Catalog No. XH8808, American Gas Association, Arlington, VA (1996).

*Fundamentals of Gas Combustion, Revised*, Catalog No. XH9601, American Gas Association, Arlington, VA (1996).

*Guidelines for Modeling Indoor Air Quality*, Nagada, N.L., Rector, H.E., and Koontz, M.D., New York, NY: Hemisphere Publishing Corporation (1987).

*National Gas Fuel Code*, NFPA Standard No. 54-1996, ANSI Standard No. Z223.1-1996, National Fire Protection Association, Quincy, MA (1996).

#### **APPENDIX A: FURNACE SPECIFICATIONS AND SETUP**

Table A1 lists some general information about the test furnace.

· /				
aft				
ı/hr				
W. C.				
ues (No. 43)				
Bimetal disc thermostat near flue outlet				
78 %				
V.C.				
CAN/CGA – 2.3a 1995				

#### TABLE A.1. Specifications of the Test Furnace (Furnace #3)

The furnace was installed according to the manufacturer's installation instructions and the National Fuel Gas Code (1996). Three-quarter inch (1.91 centimeter) black galvanized pipe was used to connect the furnace to the main gas line. A pressure tap was added before the pressure regulated so that the supply pressure could be measured. The inlet pressure generally ranged from 6.5 to 7.0 inch w.c. The furnace was placed on a 13 inch (33.0 centimeters) high platform so that the return duct would not contact the chilled water lines that ran along the floor of the chamber. The cracks between the furnace bottom and platform were sealed with aluminum tape, per the manufacturer's instructions, to prevent a "possible negative pressure condition".

Flue gases from the furnace were vented using double-wall Type B vent material having an internal diameter of 5.0 inches (12.7 centimeters). The vent pipe had a total rise of 5.60 feet (1.70 meters) and a horizontal run of approximately 4.0 feet (1.21 meters). Figure A.1 illustrates the general vent system. Due to restrictions preventing modifications to the CPSC laboratory, the flue products had to be vented outdoors using an existing vent hood. The vent hood was located at a vertical distance of 5.0 feet (1.52 meters) from the furnace and a horizontal distance of 17.0 feet (5.18 meters). Due to the venting restrictions in the National Fuel Gas Code (1996) that states that the horizontal run of the vent pipe can not exceed 75 percent of the vent hood.

Instead, the vent pipe terminated in a draft hood that was then connected to the vent hood (see Figure A.1). The draft hood was open in the back allowing air to be drawn in with the flue products and a fan was used to transfer this mixture to the vent hood. When the fan for the draft hood was on and the furnace was off, the pressure in the vent pipe was 0.00 inches w.c. Therefore, the vent hood did not affect the operation of the furnace.

The return duct consisted of a duct that was 7.1 feet (2.16 meters) long, 16 inches (40.6 centimeters) high by 19 inches (48.3 centimeters) wide. The duct was attached to the furnace return air opening using flanges and screws. Aluminum tape was used to seal all seams along the duct and at the point of attachment between the duct and furnace. Air for the return duct was obtained from an adjoining room. A vent located at the end of the room prevented the pressure from going negative in this room when the furnace was operating. The supply duct consisted of several sections. The first section was a 16 inch (40.6 centimeters) long transition piece that reduced the 19 inch (48.3 centimeter) by 18 inch (45.7 centimeter) furnace supply air opening to an 8 inch (20.3 centimeter) by 20 inch (50.8 centimeter) opening. The second section consisted of a rectangular duct that was 4.25 feet (1.30 meters) long, 8 inches (20.3 centimeter) high by 20 inches (50.8 centimeter) wide. This section was connected to a 90-degree duct. The final section was an 8 inch (20.3 centimeter) by 20 inch (50.8 centimeter) duct that was 10.6 feet (3.23 meters) long. Screws connected the various sections of the duct together and all duct seams within the closet were sealed with aluminum tape. The heated air from the supply duct was released in the main section of the laboratory. This section of the building contained a vent hood that exhausted to the outdoors and thus prevented a positive pressure from occurring in the room.

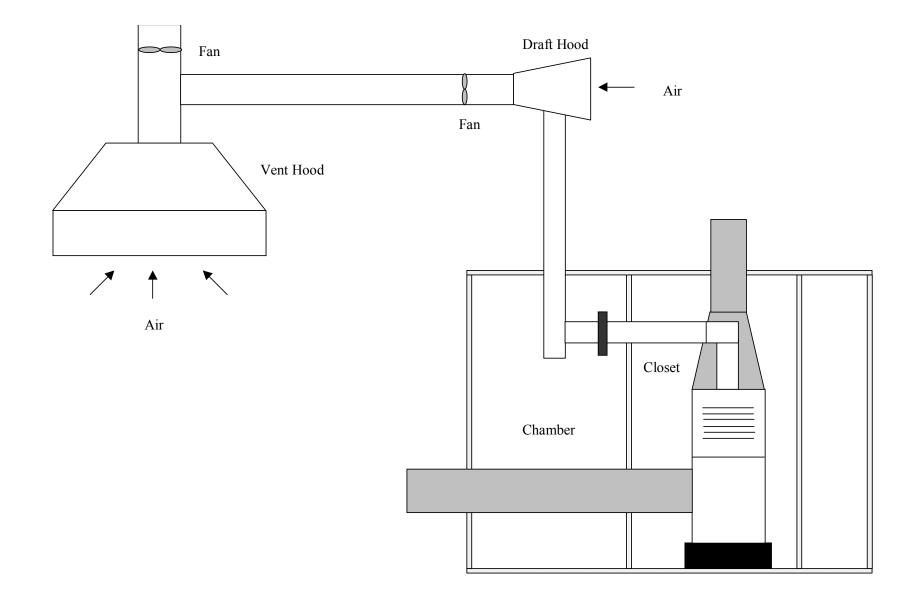


Figure A.1. Furnace Vent System Diagram

# APPENDIX B: CHAMBER AND FURNACE CLOSET DESCRIPTION

## CHAMBER

The test chamber was a modified environmental room manufactured by Hotpack. The internal dimensions of the chamber were 10 feet (3.05 meters) wide, by 12 feet (3.66 meters) long, by 7 feet (2.16 meters) high. The internal volume was 837 cubic feet (23.7 cubic meters). The inner walls of the chamber were constructed from enamel-coated aluminum. Holes were added through the chamber walls to allow for the return and supply ducts of the furnace and also for the vent pipe. Silicon glue was used to seal any gaps between the chamber walls and the ducts and vent pipe.

The temperature inside the chamber was controlled by removing heat from the chamber. This was accomplished by passing chilled water through four fin-and-tube heat exchangers located in the chamber (Figure B.1). Chilled water was provided by a recirculating chiller (Neslab, HX 750) located outside of the chamber. To assist in the cooling process, three small fans situated over each heat exchanger were used to draw air over the heat exchanger. These fans also ensured a well-mixed environment within the chamber.

The chamber was equipped with two fans to control air infiltration into the chamber. One fan brought fresh air from the laboratory into the chamber and the second fan exhausted air out of the chamber into an exhaust hood that vented outdoors.

The chamber also contained a pressure feedback system to maintain a near zero pressure differential between the chamber and the laboratory. This was done to prevent the furnace from back drafting. The feedback system consisted of the exhaust fan connected to a photohelic pressure gauge with transmitter (Dwyer, model 3000SGT). When the pressure differential exceeded the set pressure limit of  $\pm$  0.01 inches w.c., the exhaust fan would cycle off or on accordingly.

# FURNACE CLOSET

A furnace closet was erected within the chamber. The closet was constructed using ½ inch dry wall and metal studs for the framing. The outside of the closet was 4.33 feet (1.32 meters) wide by 6.25 feet (1.91 meters) long by 7.08 feet (2.16 meters) high. The closet was positioned on a 0.75 inch (1.91 centimeter) thick piece of wood located on the chamber floor. The internal volume of the closet was 196 cubic feet (5.5 cubic meters). The closet contained a door, a hole for the vent pipe, and holes for the return and supply ducts. The hole for the vent pipe provided a 0.25 to 1.0 inch clearance around the vent pipe. In order to comply with the National Fuel Gas Code (1996) and the manufacturer's installation instructions for a "Confined Space" installation, the closet contained two vent openings. Both vents had a free area of 121 square inches, which met the requirement of a minimum of 1 square inch per 1,000 Btu/hr of the input rating (at 100,000 Btu/hr input, the minimum free area would be 100 square inches). One vent was located within 12 inches of the ceiling and the other was located within 12 inches of the floor, per the instructions. The furnace was positioned inside the closet so that the manufacturer's specification for minimum distances to combustible surfaces was met.

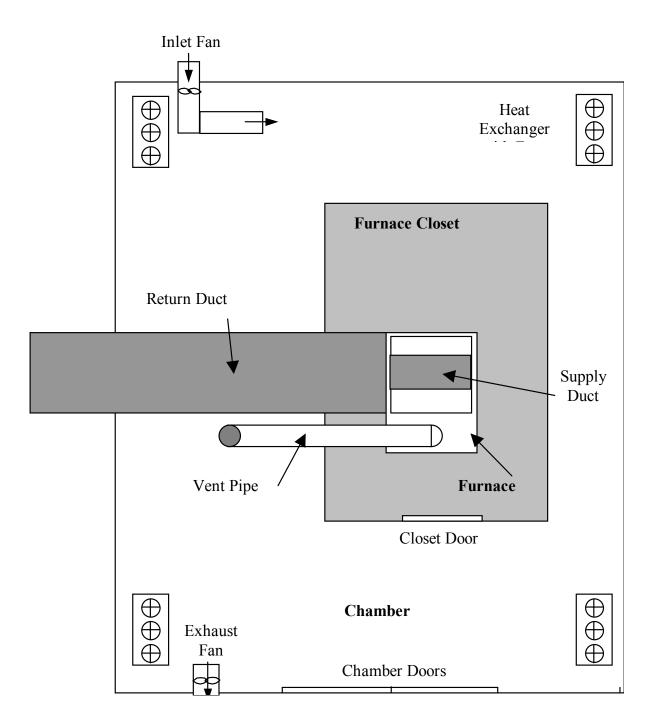


Figure B.1. Test Chamber Diagram (Top View)

## **APPENDIX C: MEASUREMENT OF FURNACE OPERATING PARAMETERS**

Figure C.1 illustrates the general locations where the different operating parameters of the furnace were measured.

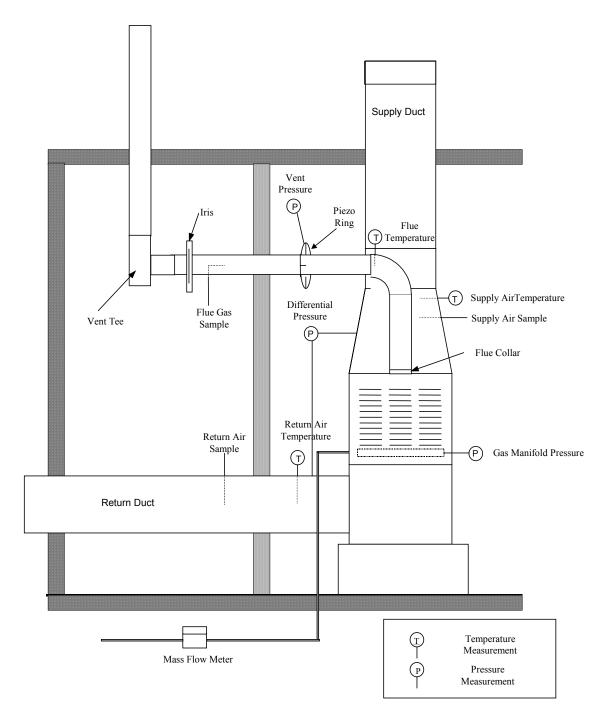


Figure C.1. Location of Measurements on Test Furnace

# Table C.1. Equipment Used to Measure the Different Operating Parameters of the Furnace

Parameter Being Measured	Equipment Type	quipment Type Manufacturer Model		Range	Accuracy	
Gas Manifold Pressure	Magnehelic Pressure Gage with Transmitter	<u> </u>		0-10 inches w.c.	$\pm 2\%$ full scale	
Differential Pressure Between the Return & Supply Air Ducts	Magnehelic Pressure Gage with Transmitter	Dwyer	605-1	0-1.0 inches w.c.	$\pm$ 2% full scale	
Vent Pressure	Magnehelic Pressure Gage	Dwyer	2301	0.5 - 0 - 0.5 inches w.c.	$\pm$ 2% full scale	
Gas Input Rate	Mass Flow Meter (methane)	Sierra	826-NX-OV1- PV1-V1	0-2 scfm	$\pm$ 1.5% full scale	
Flue Temperature, Return and Supply Air Temperature, Air Temperature Near Blocked Vent Shutoff System	Thermocouple	Omega	Type K, 28 AWG	-200 to 1250°C	2°C or 0.75% of Reading, which ever is greater	

# **APPENDIX D: GAS SAMPLING SYSTEM**

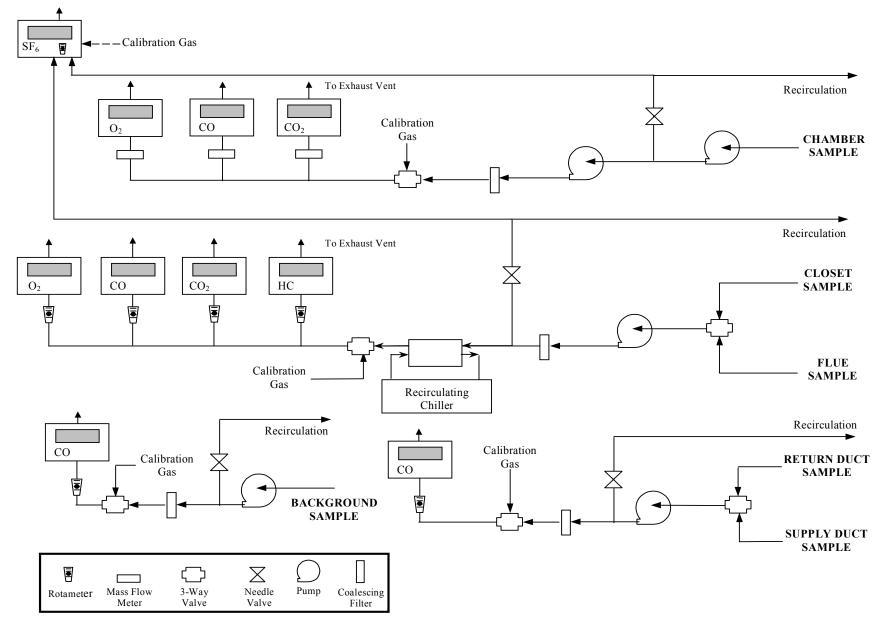


Figure D.1. Schematic of Gas Sampling Systems

Chemical Species	Location	Measuring Technique	Manufacturer	Model	Range	Accuracy
Carbon Monoxide (CO)	arbon Monoxide (CO) Closet/Flue		Non-Dispersive Infrared Rosemount		0-200 ppm, 0-1000 ppm	1% Full Scale
Carbon Dioxide (CO <sub>2</sub> )	Closet/Flue	Non-Dispersive Infrared	Rosemount	880A	0-10%, 0-20%	1% Full Scale
Oxygen (O <sub>2</sub> )	Closet/Flue	Paramagnetic	Rosemount	755R	0-25%	1% Full Scale or 0.01% O <sub>2</sub> , which ever is greater
Hydrocarbon (HC)	Hydrocarbon (HC) Closet/Flue		Rosemount	880A	0-100% LEL <sup>1</sup>	1% Full Scale
Carbon Monoxide (CO)	Carbon Monoxide (CO) Return/Supply Air		Rosemount	880A	0-100 ppm, 0-1000 ppm	1% Full Scale
Oxygen (O2)	Chamber	Paramagnetic	Rosemount	755R	0-25%	1% Full Scale or 0.01% O <sub>2</sub> , which ever is greater
Carbon Monoxide (CO)	Chamber	Non-Dispersive Infrared	Rosemount	880A	0-200 ppm, 0-1000 ppm	1% Full Scale
Carbon Dioxide (CO <sub>2</sub> )	Carbon Dioxide (CO <sub>2</sub> ) Chamber		MSA	Lira 3000	0-10%	1% Full Scale
Carbon Monoxide (CO)	Carbon Monoxide (CO) Return/Supply Air No		Beckman	866	0-100 ppm	1% Full Scale
Sulfur Hexafluoride (SF <sub>6</sub> ) Chamber and Closet		Electron Capture Gas Chromatograph	Largus Applied Technology	101	0-5 ppb	±3% of reading

 Table D.1. Equipment Used with the Gas Sampling Systems

1. Lower Explosion Limit of Methane (5% by volume)

# **APPENDIX E: FURNACE TEST MATRIX**

# Table E.1. Furnace Test Matrix Table

BASELINE TESTS
Normal
1. Baseline – Specified Rate (continuous)
2. Baseline – Specified Rate (w/cycling)
3. Baseline - "As Received" Rate (continuous)
4. Baseline - "As Received" Rate (w/cycling)
Overfire
5. 12% Over Specified Rate (continuous)
6. 12% Over Specified Rate (w/cycling)
7. 12% Over "As Received" Rate (continuous)
8. 12% Over "As Received" Rate (w/cycling)
BLOCKAGE TESTS
Normal
9. 100 % Vent Blockage @ Specified Rate (continuous)
10. 100 % Vent Blockage @ Specified Rate (w/cycling)
11. 100 % Vent Blockage @ "As Received" (continuous)
12. 100 % Vent Blockage @ "As Received" Rate (w/cycling)
13. Incremental Vent Blockage (95%, 90%, 85%, 75%, 64%, 56%, 47%) (continuous)
14. Incremental Vent Blockage (95%, 90%, 85%, 75%, 64%, 56%, 47%) (w/cycling)
15. Incremental Vent Blockage @ "As Received" Rate (95%, 90%, 85%, 75%, 64%, 56%, 47%) (continuous)
16. Incremental Vent Blockage @ "As Received" Rate (95%, 90%, 85%, 75%, 64%, 56%, 47%) (w/cycling)
Overfire
17. 100 % Vent Blockage - 12% Over Specified Rate (continuous)
18. 100 % Vent Blockage - 12% Over Specified Rate (w/cycling)
19. 100 % Vent Blockage - 12% Over "As Received" Rate (continuous)
20. 100 % Vent Blockage - 12% Over "As Received" Rate (w/cycling)
21. Incremental Vent Blockage (95%, 90%, 85%, 75%, 64%, 56%, 47%) - 12% Over Specified Rate (continuous)
22. Incremental Vent Blockage (95%, 90%, 85%, 75%, 64%, 56%, 47%) - 12% Over Specified Rate (w/cycling)
23. Incremental Vent Blockage (95%, 90%, 85%, 75%, 64%, 56%, 47%) - 12% Over "As Received" Rate (continuous)
24. Incremental Vent Blockage (95%, 90%, 85%, 75%, 64%, 56%, 47%) - 12% Over "As Received" Rate (w/cycling)


# Table E.1. Furnace Test Matrix Table (continued)

DISCONNECTED VENT TESTS
Normal
25. <sup>1</sup> / <sub>4</sub> - Inch Gap @ Specified Rate (continuous)
26. 2-Inch Gap @ Specified Rate (continuous)
27. 100% Disconnected Vent in Closet @ Specified Rate (continuous)
28. 100% Disconnected Vent in Chamber @ Specified Rate (w/cycling)
29. 100% Disconnected Vent in Closet @ "As Received" Rate (continuous)
30. 100% Disconnected Vent in Chamber @ "As Received" Rate (w/cycling)
Overfire
31. <sup>1</sup> / <sub>4</sub> - Inch Gap – 12% Over Specified Rate (continuous)
32. 2-Inch Gap - 12% Over Specified Rate (continuous)
33. 100% Disconnected Vent in Closet - 12% Over Specified Rate (continuous)
34. 100% Disconnected Vent in Closet - 12% Over Specified Rate (w/cycling)
35. 100% Disconnected Vent in Chamber - 12% Over Specified Rate (continuous)
36. 100% Disconnected Vent in Chamber - 12% Over Specified Rate (w/cycling))
37. 100% Disconnected Vent in Closet - 12% Over "As Received" Rate (continuous)
38. 100% Disconnected Vent in Closet - 12% Over "As Received" Rate (w/cycling)
39. 100% Disconnected Vent in Chamber - 12% Over "As Received" Rate (continuous)
40. 100% Disconnected Vent in Chamber - 12% Over "As Received" Rate (w/cycling)

#### APPENDIX F: DERIVATION OF AIR EXCHANGE RATE AND EMISSION RATE

#### Air Exchange Rate

The air exchange rate in the chamber can be derived from a simple mass balance on the chamber. Figure F.1 illustrates the different flows into and out of the chamber. The chamber boundaries are displayed using a dashed line. A tracer gas is injected into the chamber (designated as  $S_{inj}$ ) and the gas concentration (C) is measured inside the chamber over time. The number of air exchanges per hour inside the chamber is controlled by the amount of air brought into ( $Q_{in}$ ) and out of ( $Q_{out}$ ) the chamber. An allowance has been made for leakage ( $Q_{leak}$ ) into the return duct. For this simple model, it is assumed that the furnace closet does not interact with the chamber, but behaves as a "black box". This assumption can be made if the concentration of the tracer gas in the closet is approximately the same as the concentration in the chamber.

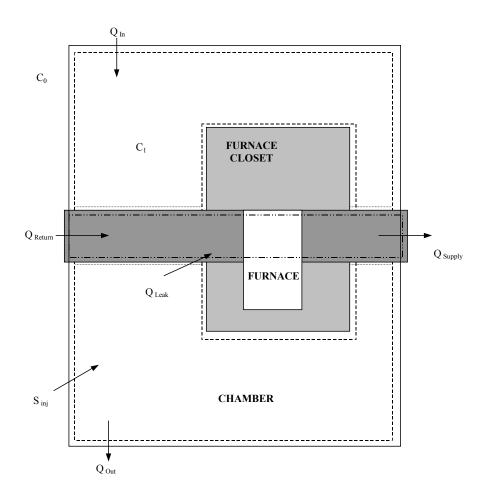

#### Figure F.1. Model of Test Chamber Used to Derive Air Exchange Rate Equation

Figure F.1 applies to the situation where the vent pipe is totally disconnected or fully blocked. When the vent pipe is intact or partially blocked, a portion of air from the chamber exits through the furnace's vent pipe. This is the air used in the combustion process (primary and secondary air) and by the draft hood. Since a pressure control system is used to maintain a zero pressure differential between the chamber and the surrounding laboratory, less air exits the chamber through the chamber's exhaust fan when the furnace is operating. To simplify the model, any air that would be exhausted through the vent pipe to the outdoors will be combined with the term for the flow out of the chamber ( $Q_{out}$ ).

Based on Figure F.1, a mass balance for chemical specie C inside the chamber yields the following equation:

$$V\frac{dC_{1}}{dt} = C_{0}Q_{in} - C_{1}Q_{out} - C_{1}Q_{leake} + S_{inj}$$
[F.1]

where,

V = volume inside the chamber less the closet and the return duct, m<sup>3</sup>

 $C_1$  = concentration of the tracer gas in the chamber, 0.001 cc/m<sup>3</sup> or ppb

 $C_0$  = concentration of the tracer gas present in the background, 0.001 cc/m<sup>3</sup> or ppb

 $Q_{in} =$  flow rate of air into the chamber, m<sup>3</sup>/hr

 $Q_{out}$  = flow rate of air out of the chamber, m<sup>3</sup>/hr

 $Q_{leak}$  = leak rate of air into the return/supply duct, m<sup>3</sup>/hr

 $S_{inj}$  = injection rate of tracer gas, cc/hr

In equation F.1, the following has been assumed: the air in the chamber is well mixed, the tracer gas does not get absorbed inside the chamber, any leakage from the supply duct to the chamber has been neglected, and the tracer gas does not get consumed in the burner flame.

Since a pressure control system is used to maintain a zero pressure differential between the chamber and the surrounding laboratory, the following equation can be written for the mass flow of air into and out of the chamber.

$$Q_{in} = Q_{out} + Q_{leak}$$
 [F.2]

Equation F.1 can be rewritten using the relationship in Equation F.2 as follows:

$$V\frac{dC_{1}}{dt} = C_{0}Q_{in} - C_{1}Q_{in} + S_{inj}$$
[F.3]

or

$$\frac{dC_1}{dt} = \frac{C_0 Q_{in}}{V} - \frac{C_1 Q_{in}}{V} + \frac{S_{inj}}{V}$$
[F.4]

At steady state, the rate of change of the chemical specie C inside the chamber is zero.

$$\frac{dC_1}{dt} = 0$$
 [F.5]

The number of air changes per hour (ACH) in the chamber can be defined by the following equation:

$$ACH = \frac{Q_{in}}{V}$$
[F.6]

Assuming that the background concentration of the tracer gas is zero, Equations F.5 and F.6 can be substituted into Equation F.4 to yield the following equation:

$$0 = 0 - C_1 A C H + \frac{S_{inj}}{V}$$
[F.7]

Solving for ACH in Equation F.7 yields,

$$4CH = \frac{S_{inj}}{C_{1_{eq}}V}$$
[F.8]

where  $C_{1 eq}$  is the equilibrium concentration of the tracer gas.

#### CO EMISSION RATE

The equation for the CO emission rate from the furnace can be derived using a method similar to that used to derive the air exchange rate equation (Equation F.8). Figure F.2 illustrates the different flows into and out of the chamber. The only difference between Figures F.1 and F.2 is that the term for the injection rate ( $S_{inj}$ ) of the tracer gas is replaced with a term for the CO emission rate ( $E_{CO}$ ) from the furnace. For this simple model, the furnace closet and furnace are combined to form a single "black box" emission source.

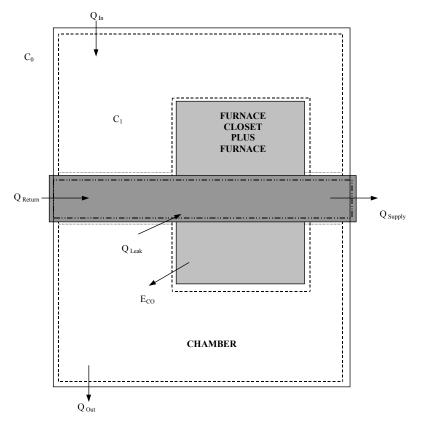


Figure F.2. Model of Test Chamber Used to Derive CO Emission Rate Equation

Based on Figure F.2, a mass balance for chemical specie C inside the chamber yields the following equation:

$$V\frac{dC_{1}}{dt} = C_{0}Q_{in} - C_{1}Q_{out} - C_{1}Q_{leake} + E_{CO}$$
[F.9]

where,

V = volume inside the chamber less the closet and the return and supply ducts, m<sup>3</sup>

 $C_1$  = concentration of carbon monoxide in the chamber, cc/m<sup>3</sup> or ppm

 $C_0$  = concentration of carbon monoxide present in the background, cc/m<sup>3</sup> or ppm

 $Q_{in}$  = flow rate of air into the chamber, m<sup>3</sup>/hr

 $Q_{out} =$  flow rate of air out of the chamber, m<sup>3</sup>/hr

 $Q_{leak}$  = leak rate of air into the return/supply duct, m<sup>3</sup>/hr

 $E_{CO}$  = emission rate of carbon monoxide from the furnace/furnace closet, cc/hr

Following a method similar to that used to derive the air exchange rate equation, Equation F.9 can be reduced and rearranged to yield the CO emission rate.

$$E_{CO} = C_{CO_{ex}} ACH V$$
 [F.10]

where  $C_{COeq}$  is the equilibrium concentration of CO in the chamber.

# APPENDIX G. TEST DATA RESULTS

Test Number <sup>1</sup>	Nominal <sup>2</sup> Input Rate	Mode of Operation <sup>3</sup>	Average		e CO Concei om)	ntrations	Air Exchange Rate	Rate
	(Btu/hr)		Chamber	Closet	Supply Air	Flue Gas <sup>4</sup>	(1/hr)	(cc/hr)
12	110,000	Continuous	0	0	0	39	11.1	0
0	117,000	Continuous	0	0	0	32	10.0	0
30	123,000	Continuous	0	0	0	32	10.6	0
21	133,000	Continuous	0	2	0	33	11.3	0
43	110,000	Cycling	0	0	0	54	11.8	0
41	117,000	Cycling	0	0	0	35	11.6	0
39	123,000	Cycling	0	0	0	28	11.7	0
40	133,000	Cycling	0	0	0	33	11.3	0

#### **Table G.1. Baseline Test Results**

1. Test Numbers correspond to the order in which the test was performed and do not relate to the numbers in the Test Matrix (Appendix E).

2. Actual input rates are  $\pm$  3 percent of the stated values.

3. Cycling rate is 8 minutes on and 2 minutes off.

4. The CO present in the flue gas is specified on an air-free basis.

Test Number <sup>1</sup>	Degree of Vent Blockage (%)	Location of Blockage	Nominal <sup>2</sup> Input Rate (Btu/hr)	Mode of Operation	Did Furnace Shut Off?	Approximate Time of Shut Off	Average Steady-State CO Concentrations (ppm)			Air Exchange Rate (1/hr)	CO Emission Rate (cc/hr)	
						(min:sec)	Chamber	Closet	Supply Air	Flue Gas <sup>4</sup>		
16	47	Iris	110,000	No	No	N/A	0	0	0	37	11.2	0
9	47	Iris	119,000	No	No	N/A	0	1	0	39	11.0	0
32	47	Iris	123,000	No	No	N/A	0	0	0	31	10.7	0
25	47	Iris	133,000	No	No	N/A	0	0	0	35	11.2	0
10	56	Iris	119,000	No	Yes	1:00	N/A	N/A	N/A	N/A	N/A	N/A
8	64	Iris	119,000	No	Yes	1:00	N/A	N/A	N/A	N/A	N/A	N/A
7	75	Iris	119,000	No	Yes	0:20	N/A	N/A	N/A	N/A	N/A	N/A
6	85	Iris	119,000	No	Yes	0:20	N/A	N/A	N/A	N/A	N/A	N/A
5	90	Iris	119,000	No	Yes	1:20	N/A	N/A	N/A	N/A	N/A	N/A
4	95	Iris	119,000	No	Yes	0:40	N/A	N/A	N/A	N/A	N/A	N/A
17	100	Vent Outlet	110,000	No	Yes	0:20	N/A	N/A	N/A	N/A	N/A	N/A
3	100	Iris	119,000	No	Yes	0:20	N/A	N/A	N/A	N/A	N/A	N/A
11	100	Vent Outlet	119,000	No	Yes	0:40	N/A	N/A	N/A	N/A	N/A	N/A
33	100	Vent Outlet	123,000	No	Yes	0:20	N/A	N/A	N/A	N/A	N/A	N/A
26	100	Vent Outlet	133,000	No	Yes	0:40	N/A	N/A	N/A	N/A	N/A	N/A
15	100 to 56	Iris	110,000	No	Yes	All < 1:00	N/A	N/A	N/A	N/A	N/A	N/A
31	100 to 56	Iris	123,000	No	Yes	All < 1:00	N/A	N/A	N/A	N/A	N/A	N/A
24	100 to 56	Iris	133,000	No	Yes	All < 1:00	N/A	N/A	N/A	N/A	N/A	N/A
38	100 to 56	Iris	123,000	Yes	Yes	All < 1:00	N/A	N/A	N/A	N/A	N/A	N/A

1. Test Numbers correspond to the order in which the test was performed and do not relate to the numbers in the Test Matrix (Appendix E).

2. Actual input rates are  $\pm$  3% of the stated values.

3. Cycling rate is 8 minutes on and 2 minutes off.

4. The CO present in the flue gas is specified on an air-free basis.

Test Number <sup>1</sup>	Size of Disconnect	Location of Vent Disconnection	Nominal <sup>2</sup> Input Rate	Mode of Operation <sup>3</sup>	Average	e Steady-Sta (p	Air Exchange Rate	CO Emission Rate		
			(Btu/hr)		Chamber	Closet	Supply Air	Flue Gas <sup>4</sup>	(1/hr)	(cc/hr)
13	100%	Closet	110,000	Continuous	35	55	0	221	11.8	7,360
1	100%	Closet	119,000	Continuous	28	41	0	176	10.9	5,447
34 <sup>5</sup>	100%	Closet	123,000	Continuous	29	49	0	113	11.4	5,906
22	100%	Closet	133,000	Continuous	51	84	0	240	11.9	10,816
14	100%	Chamber	110,000	Continuous	30	29	0	221	12.5	6,711
2	100%	Chamber	119,000	Continuous	26	26	0	127	11.3	5,253
35	100%	Chamber	123,000	Continuous	28	27	0	170	12.1	6,058
23	100%	Chamber	133,000	Continuous	40	40	0	373	11.7	8,340
44	100%	Closet	110,000	Cycling	23	38	0	232	11.9	4,915
18	100%	Closet	119,000	Cycling	22	36	0	137	11.7	4,591
36	100%	Closet	123,000	Cycling	27	46	0	107	12.1	5,852
27	100%	Closet	133,000	Cycling	30	51	0	47	11.7	6,287
45	100%	Chamber	110,000	Cycling	26	25	0	191	12.2	5,658
42	100%	Chamber	119,000	Cycling	25	23	0	137	12.0	5,382
37	100%	Chamber	123,000	Cycling	23	25	0	113	12.4	5,096
28	100%	Chamber	133,000	Cycling	30	46	0	54	12.2	6,534

# Table G.3. Disconnected Vent Test Results

# Table G.3. Disconnected Vent Test Results (continued)

Test Number <sup>1</sup>	Size of Disconnect	Location of Vent Disconnection	Input Rate <sup>2</sup> (Btu/hr)	Mode of Operation <sup>3</sup>	Average		te CO Concer pm)	Air Exchange Rate	CO Emission Rate	
					Chamber	Closet	Supply Air	Flue Gas <sup>4</sup>	(1/hr)	(cc/hr)
29	1.2 inch gap	Chamber	133,000	Continuous	0	0	0	30	10.5	0
19 <sup>6</sup>	100%	Closet	119,000	Continuous	36	62	0	291	11.6	7,473
$20^{6}$	100%	Chamber	119,000	Continuous	40	39	0	430	12.1	8,662

1. Test Numbers correspond to the order in which the test was performed and do not relate to the numbers in the Test Matrix (Appendix E).

2. Actual input rates are  $\pm$  3% of the nominally stated values.

3. Cycling rate is 8 minutes on and 2 minutes off.

4. The CO present in the flue gas is specified on an air-free basis.

5. After the vent was disconnected, the disc thermostat was tripped, shutting off the furnace. The disc thermostat was reset and the furnace continued to operate.

6. A metal shield was installed between the inducer fan and the burners.

Test Number <sup>2</sup>	Vent Condition	Nominal <sup>3</sup> Input Rate	Mode of Operation	Did Furnace Shut off?	Average Steady-State CO Concentrations (ppm)				Air Exchange Rate	CO Emission Rate
		(Btu/hr)			Chamber	Closet	Supply Air	Flue Gas <sup>4</sup>	(1/hr)	(cc/hr)
47	Blocked: 56 to 100 percent	119,000	Continuous	Yes	N/A	N/A	N/A	N/A	N/A	N/A
48	Vent Pipe Totally Disconnected Inside Closet	119,000	Continuous	No	28	46	0	332	11.5	5,820
49	Blocked: 56 to 100 percent	119,000	Continuous	Yes	N/A	N/A	N/A	N/A	N/A	N/A

# Table G.4. Reduced Supply Voltage<sup>1</sup> Test Results

1. Supply voltage was reduced to 85 percent of its normal value (120 volts).

2. Test Numbers correspond to the order in which the test was performed and do not relate to the numbers in the Test Matrix (Appendix E).

3. Actual input rates are  $\pm$  3% of the nominally stated values.

4. The CO present in the flue gas is specified on an air-free basis.