

PURAFIL ENVIRONMENTAL CORROSION REPORT


20-Dec-2010

Company: 116801

Sales Order #: C002726
CCC Panel #: P68761
Date In: 16-Nov-2010
Date Out: 30-Nov-2010
Days In Service: 14

Room/Area ID:

Reference #:

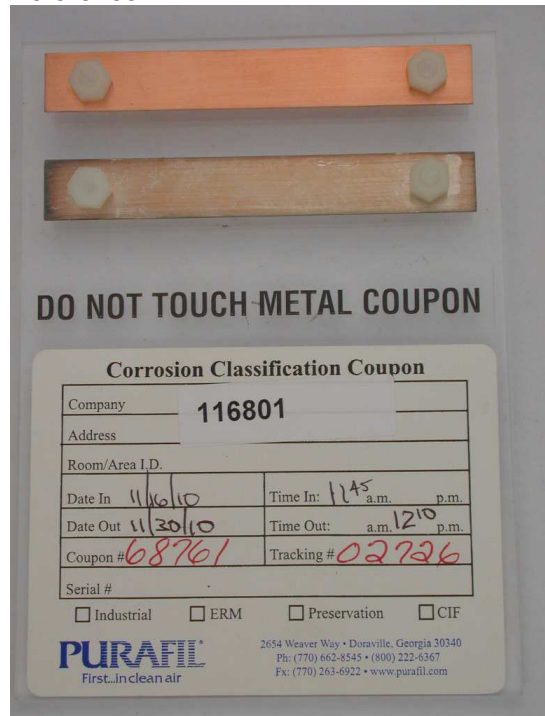

DO NOT TOUCH METAL COUPON

Corrosion Classification Coupon

Company 116801	
Address	
Room/Area I.D.	
Date In 11/16/10	Time In: 11:45 a.m. p.m.
Date Out 11/30/10	Time Out: a.m. 12:10 p.m.
Coupon # 68761	Tracking # 02726
Serial #	
☐ Industrial ☐ ERM ☐ Preservation ☐ CIF	

PURAFIL
First.Inclean air

2654 Weaver Way • Doraville, Georgia 30340
Ph: (770) 662-8545 • (800) 222-6367
Fk: (770) 263-6922 • www.purafil.com

CCC Panel # P68761**ISA Class G1**
Mild**Copper Corrosion**
294 Å/30 Days**Silver Corrosion**
471 Å/30 Days

(see next page for complete analysis)

Summary for PURAFIL CCC # P68761

The electrolytic reduction analysis on Corrosion Classification Coupon #P68761 shows the presence of only very low concentrations of contaminants in the environment tested. The hydrogen sulfide level is not expected to exceed 3 ppb and the sulfur dioxide level should be less than 10 ppb. During the test period, corrosion, as shown by the copper coupon, is not a factor in determining equipment reliability.

Please note: Copper's reactivity is sensitive to temperature and relative humidity and can therefore exhibit seasonal variation. For example, below 30% relative humidity (typical for heated indoor air in winter), copper readings will be dramatically reduced. However, silver's reactivity is not affected by temperature and relative humidity. Due to the elevated level of film growth on the silver coupon, corrosion may be a factor in determining equipment reliability; continued monitoring is recommended.

Your local representative for additional information and assistance is:

Environmental Health and Eng
117 Fourth Avenue, Needham MA 02494, USA
tminegishi@eheinc.com

Purafil, Inc. / 2654 Weaver Way, Doraville GA 30340 USA / (770) 662-8545 / (770) 263-6922
Email: purafil@purafil.com / Internet: <http://www.purafil.com>

Displaying Page 1 [Display Page 2](#)

PURAFIL CCC # P68761 Analysis Results

Corrosion Film Composition				Gold Coupon - Magnified 20x
	Projections			
	<u>30 Days</u>	<u>1 Year</u>	<u>5 Year</u>	
Copper Films				
Cu ₂ S	196 Å	262 Å	342 Å	
Cu ₂ O	98 Å	131 Å	171 Å	
Unknowns	0 Å	0 Å	0 Å	
Totals	294 Å	393 Å	513 Å	
Silver Films				
AgCl	0 Å	0 Å	0 Å	
Ag ₂ S	471 Å	5735 Å	28673 Å	
Unknowns	0 Å	0 Å	0 Å	
Totals	471 Å	5735 Å	28673 Å	
Gold Pore Corrosion:				
Note: 1000 Å = 0.1 micron				

Equipment Reliability Correlation
(ISA Standard S71.04-1985 for Copper)

