

PURAFIL ENVIRONMENTAL CORROSION REPORT


17-Nov-2010

Company: 118609

Sales Order #: C002726
CCC Panel #: P68798
Date In: 19-Oct-2010
Date Out: 01-Nov-2010
Days In Service: 13

Room/Area ID:

Reference #:

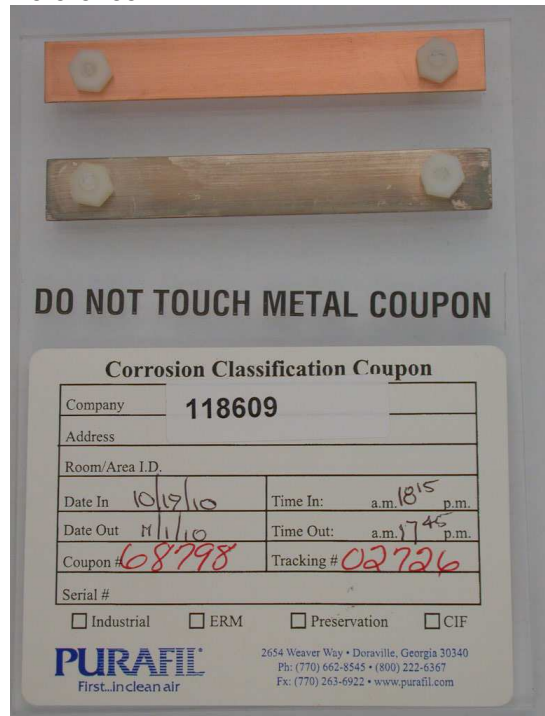

DO NOT TOUCH METAL COUPON

Corrosion Classification Coupon

Company 118609	
Address	
Room/Area I.D.	
Date In 10/19/10	Time In: a.m. 18¹⁵ p.m.
Date Out 11/1/10	Time Out: a.m. 7⁴⁵ p.m.
Coupon # 68798	Tracking # 02726
Serial #	

☐ Industrial ☐ ERM ☐ Preservation ☐ CIF

PURAFIL
First...in clean air

2654 Weaver Way • Doraville, Georgia 30340
Ph: (770) 662-8545 • (800) 222-6367
Fx: (770) 263-6922 • www.purafil.com

CCC Panel # P68798

ISA Class G1
Mild

Copper Corrosion
268 Å/30 Days

Silver Corrosion
669 Å/30 Days

(see next page for complete
analysis)

Summary for PURAFIL CCC # P68798

The electrolytic reduction analysis on Corrosion Classification Coupon #P68798 shows the presence of only very low concentrations of contaminants in the environment tested. The hydrogen sulfide level is not expected to exceed 3 ppb and the sulfur dioxide level should be less than 10 ppb. During the test period, corrosion, as shown by the copper coupon, is not a factor in determining equipment reliability.

Please note: Copper's reactivity is sensitive to temperature and relative humidity and can therefore exhibit seasonal variation. For example, below 30% relative humidity (typical for heated indoor air in winter), copper readings will be dramatically reduced. However, silver's reactivity is not affected by temperature and relative humidity. Due to the elevated level of film growth on the silver coupon, corrosion may be a factor in determining equipment reliability; continued monitoring is recommended.

Your local representative for additional information and assistance is:

Environmental Health and Eng
117 Fourth Avenue, Needham MA 02494, USA
tminegishi@eheinc.com

Purafil, Inc. / 2654 Weaver Way, Doraville GA 30340 USA / (770) 662-8545 / (770) 263-6922
Email: purafil@purafil.com / Internet: http://www.purafil.com

Displaying Page 1 [Display Page 2](#)

PURAFIL CCC # P68798 Analysis Results

Corrosion Film Composition				Gold Coupon - Magnified 20x
	Projections			
	<u>30 Days</u>	<u>1 Year</u>	<u>5 Year</u>	
Copper Films				
Cu ₂ S	0 Å	0 Å	0 Å	
Cu ₂ O	268 Å	353 Å	462 Å	
Unknowns	0 Å	0 Å	0 Å	
Totals	268 Å	353 Å	462 Å	
Silver Films				
AgCl	0 Å	0 Å	0 Å	
Ag ₂ S	669 Å	8147 Å	40733 Å	
Unknowns	0 Å	0 Å	0 Å	
Totals	669 Å	8147 Å	40733 Å	
Gold Pore Corrosion:				
Note: 1000 Å = 0.1 micron				

Equipment Reliability Correlation
(ISA Standard S71.04-1985 for Copper)

