CCC - P68839 Page 1 of 1

PURAFIL ENVIRONMENTAL CORROSIVITY REPORT

03-Dec-2010

Company: 118706

Room/Area ID: Reference #:



 Sales Order #:
 C002726

 CCC Panel #:
 P68839

 Date In:
 01-Nov-2010

 Date Out:
 15-Nov-2010

Days In Service: 14

CCC Panel # P68839

ISA Class G1 Mild

Copper Corrosion 270 Å/30 Days

Silver Corrosion 972 Å/30 Days

(see next page for complete analysis)

Summary for PURAFIL CCC # P68839

The electrolytic reduction analysis on Corrosion Classification Coupon #P68839 shows the presence of only very low concentrations of contaminants in the environment tested. The hydrogen sulfide level is not expected to exceed 3 ppb and the sulfur dioxide level should be less than 10 ppb. During the test period, corrosion, as shown by the copper coupon, is not a factor in determining equipment reliability.

Please note: Copper's reactivity is sensitive to temperature and relative humidity and can therefore exhibit seasonal variation. For example, below 30% relative humidity (typical for heated indoor air in winter), copper readings will be dramatically reduced. However, silver's reactivity is not affected by temperature and relative humidity. Due to the elevated level of film growth on the silver coupon, corrosion may be a factor in determining equipment reliability; continued monitoring is recommended.

Your local representative for additional information and assistance is:

Environmental Health and Eng

117 Fourth Avenue, Needham MA 02494, USA

tminegishi@eheinc.com

Purafil, Inc. / 2654 Weaver Way, Doraville GA 30340 USA / (770) 662-8545 / (770) 263-6922 Email: purafil@purafil.com / Internet: http://www.purafil.com

Displaying Page 1 Display Page 2


CCC - P68839 Page 1 of 1

PURAFIL CCC # P68839 Analysis Results

Corrosion Film Composition Projections				Gold Coupon - Magnified 20x
	<u>30 Days</u>	1 Year	<u>5 Year</u>	magimica zox
Copper Films				
Cu ₂ S	o Å	0 Å	0 Å	
Cu ₂ O	270 Å	360 Å	471 Å	
Unknowns	o Å	0 Å	0 Å	
Totals	270 Å	360 Å	471 Å	
Silver Films				
AgCl	0 Å	0 Å	0 Å	
Ag ₂ S	972 Å	11835 Å	59176 Å	
Unknowns	o Å	0 Å	0 Å	
Totals	972 Å	11835 Å	59176 Å	
Gold Pore Corrosion: Note: 1000 Å = 0.1 micron				

Equipment Reliability Correlation

(ISA Standard S71.04-1985 for Copper)

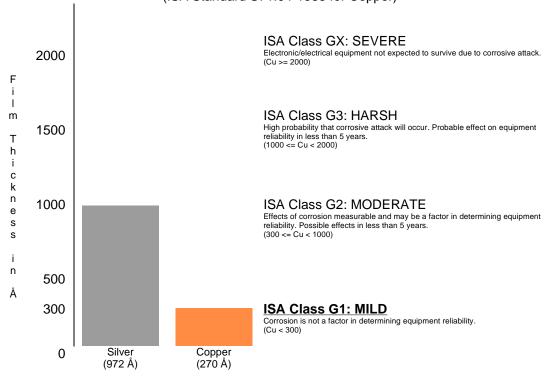

Displaying Page 2 <u>Display Page 1</u>