080509FL01

ENVIRONMENTAL
HEALTH & ENGINEERING

Environmental Health & Engineering, Inc.

117 Fourth Avenue
Needham, MA
02494-2725

TEL 800-825-5343
781-247-4300
FAX 781-247-4305

www.eheinc.com

Home Inspection/Questionnair Form

House ID 23A SE 44TH

Date 8/5/09

Field Technician(s) TMM, DEH, DSJ

House Address (b)(6)

General Weather Description 92°F HUMID, HOT

1. Questionnaire

1) Interviewed home owner — YES (BROTHER) NO

2) Age of the House (years)

1967 14 YR CURRENT OWNER

3) Estimated Floor Area (sqft)

1350 ft²

4) Was as there any demo's to the house?

YES NO

If YES, when was it done? Please Explain.

BATHROOM TILE, ROOF

5) Has there been any fire in the building?

YES NO

If YES, when did it happen? Please Explain.

6) Any pesticides/herbicides been applied around the building or in the yard?

YES NO

If YES, when was it applied? Please list the type of chemicals used.

INSIDE & OUT CORNERS

GARYS PEST CONTROL, CITY CORP

– evidence of cockroaches

7) Has there been any recent painting/staining done in the home?

YES NO

If YES, when, where and what type of paint/stain was used?

6 MONTHS - LIVING ROOM

8) Has any work been done on the AC system since construction?

YES NO

If YES, please describe?

SERVICED, REPLACED 5 YEARS AGO

9) Are all the AC system components original?

YES NO

If NO, please describe? ductwork etc. but package UNIT

10) What is the age of your refrigerator?

1.5 years

11) Has any piping been replaced in the home?

YES NO

If YES, please describe?

KITCHEN FAUCET, 3 MONTHS

2. Building Characteristics

1) Residential Type (Single/Multi-Family Building) If multi-family, how many units?

SINGLE FAMILY

2) Number of rooms

6 ROOMS, 2 BED, 2 BATH

3) Above grade Construction

EXTERIOR

(Wood Frame) (Concrete) Stone Brick Other _____

4) Basement

Full Crawlspace (Slab) Other _____

5) Foundation

Concrete Cinder Block Stone Other_____

6) Garage

(YES) NO

If YES, (Attached) Detached

If YES, Used for Car Parking? YES (NO)

If YES, Any gas-powered equipment or cans of gasoline/fuels stored?

(YES) NO

POWERWASHER

DBS

7) Type of HVAC System

3 TON DX PACKAGED - ELECTRIC STRIP HEATER - AIR DUCTS RUN TO UNIT OUTSIDE NEXT TO GARAGE

(b)(3):CPSA Section 6(b)

Make INTERNATIONAL COMFORT PRODUCTS HVAC Model PA0536AK NS Condenser Model _____

8) Types of Fuel (circle all that apply)

Natural Gas Fuel Oil Kerosene (Electric)

Propane Solar Wood Coal

9) Water Supply

(Public) Well Other _____

10) Sewage

(Public) Septic Leach Field Other _____

11) Attic

Finished (Unfinished)

INSULATED 1 ½ YEARS

CRAWL SPACE

3. Interior Characteristics

1) Any odors upon entering the building?

YES NO

If YES, describe _____

2) Fireplace

YES NO

3) Floors (circle all that apply)

Hardwood Carpet Ceramic Tile Vinyl Tile

Unfinished Wood Unfinished Concrete Other _____

4) Walls (circle all that apply)

Wall Paper Paint Skim Coat Textured SLIGHT

Wood or Wood Paneling Other _____

5) Ceiling (circle all that apply)

WHITE

Wall Paper Paint Skim Coat Textured

Wood or Wood Paneling Other _____

House Address (b)(6)

Page 1

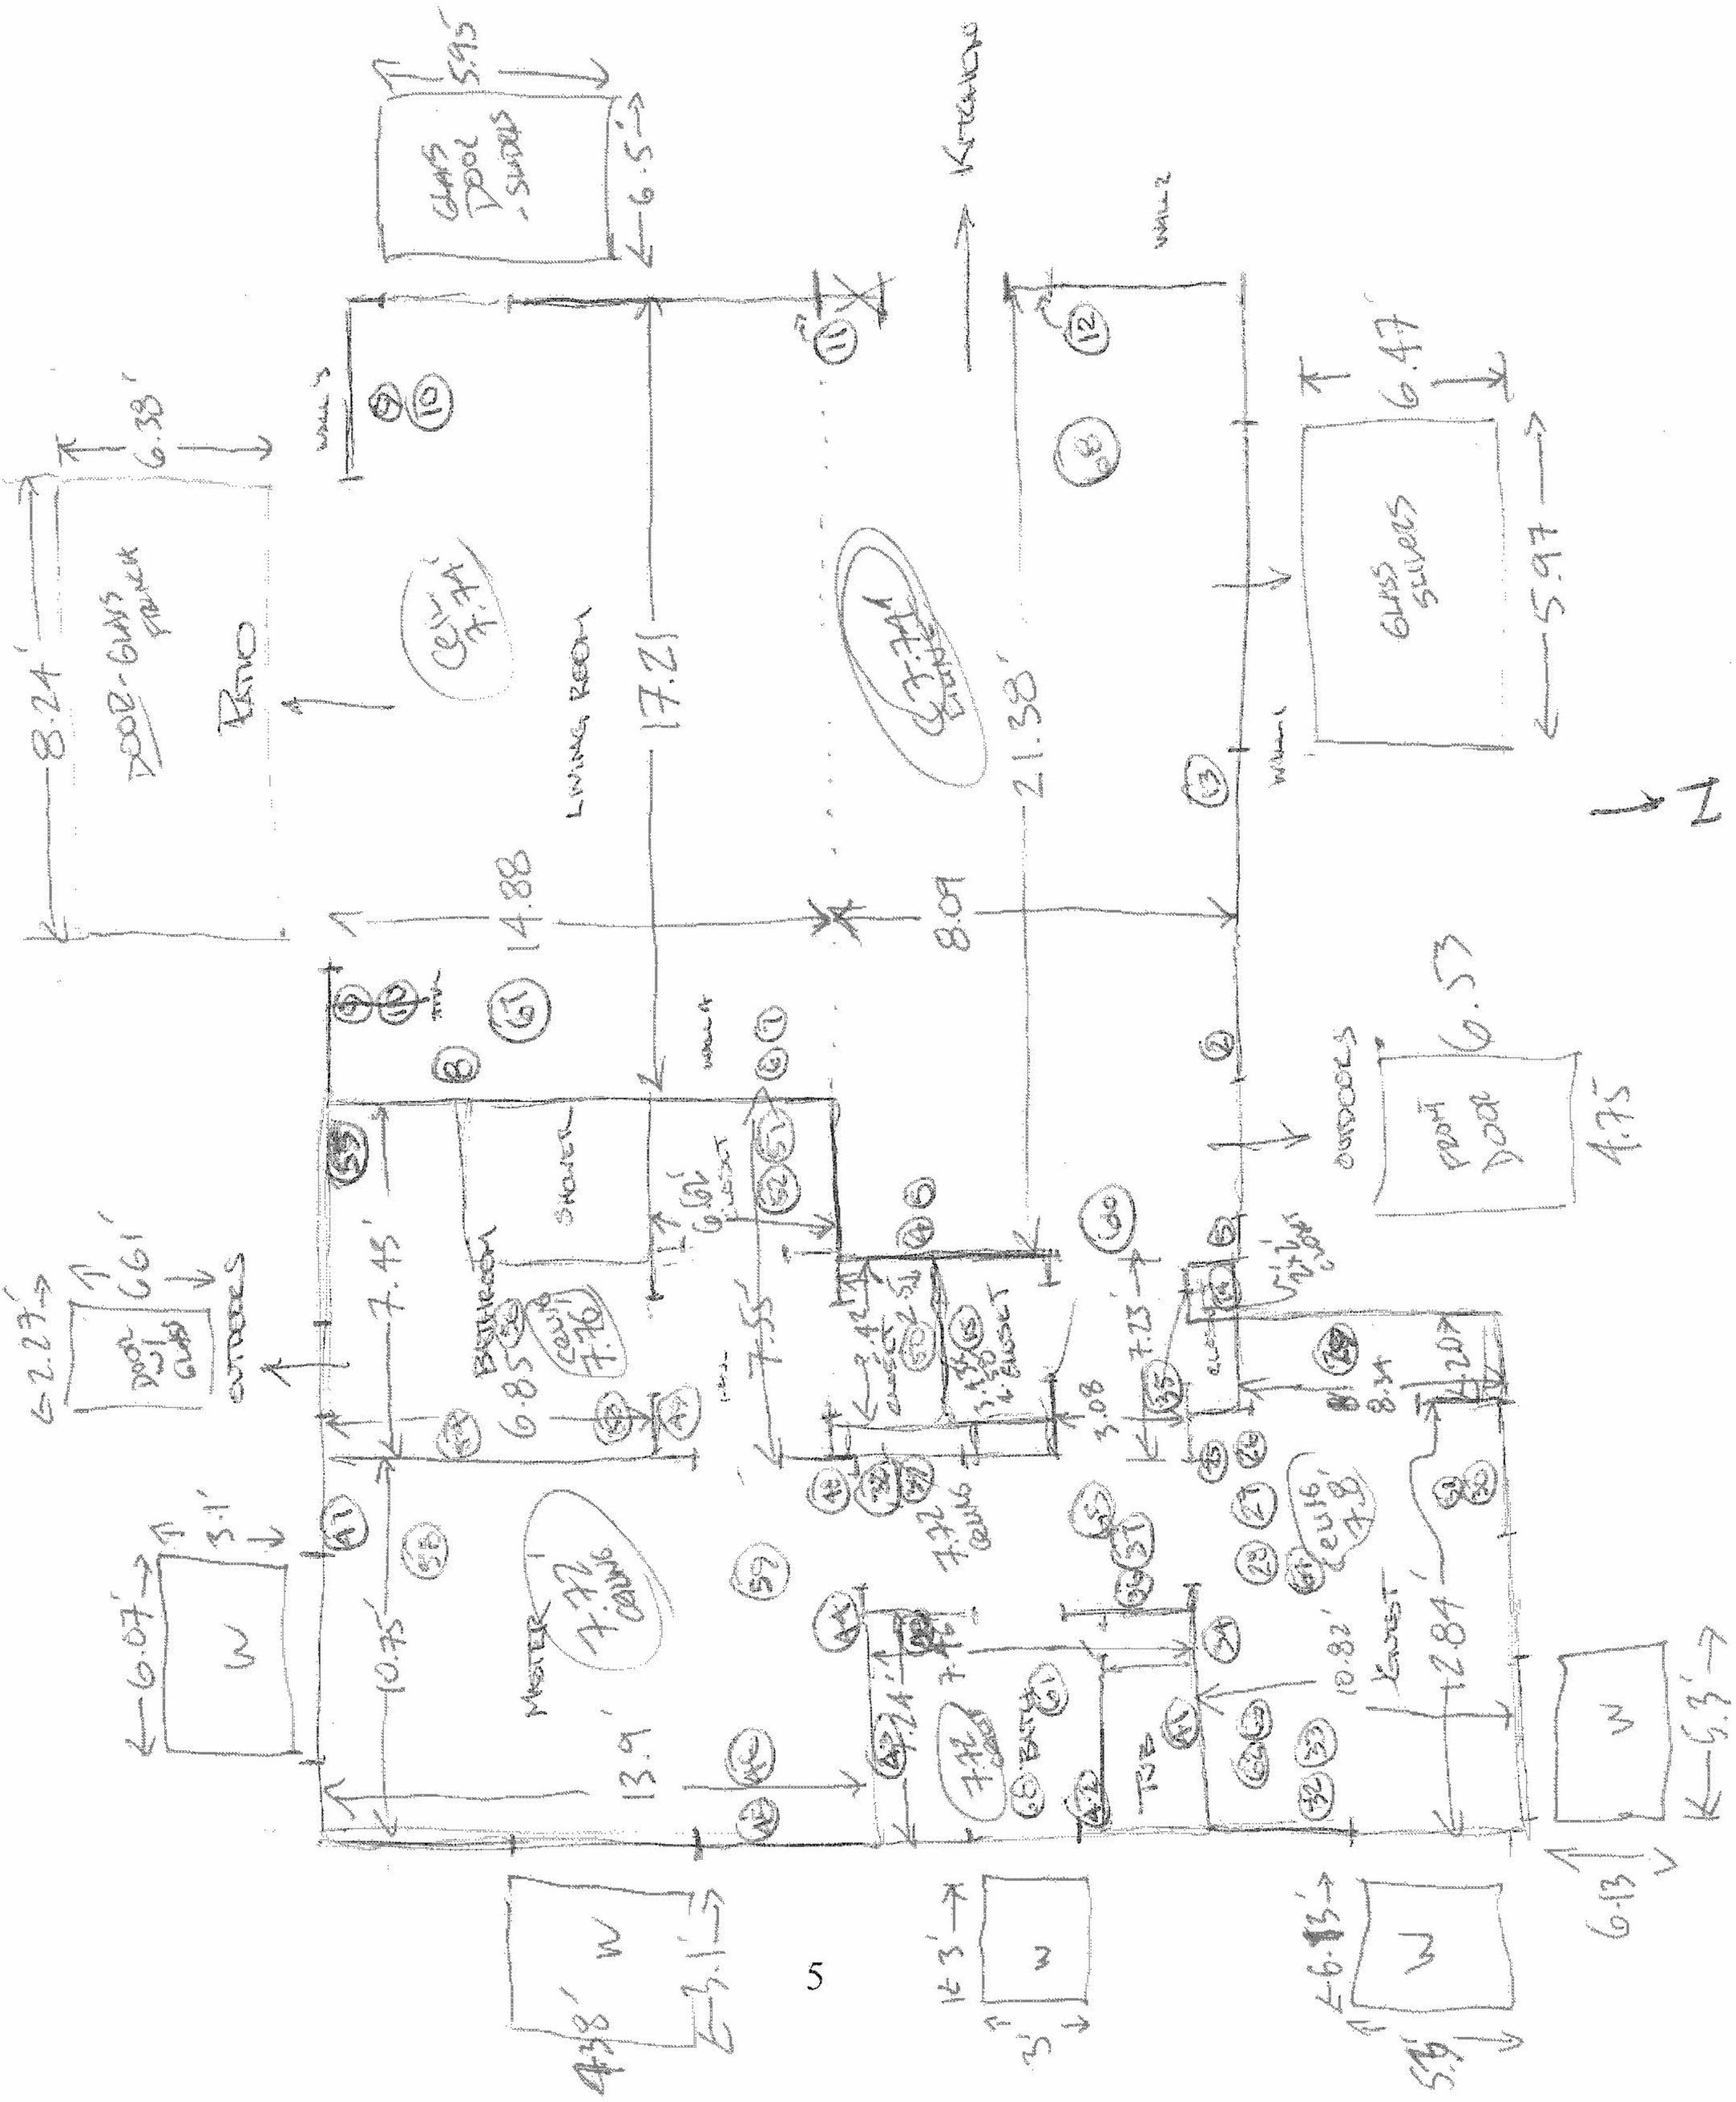

House Address (b)(6)

Page 2/2

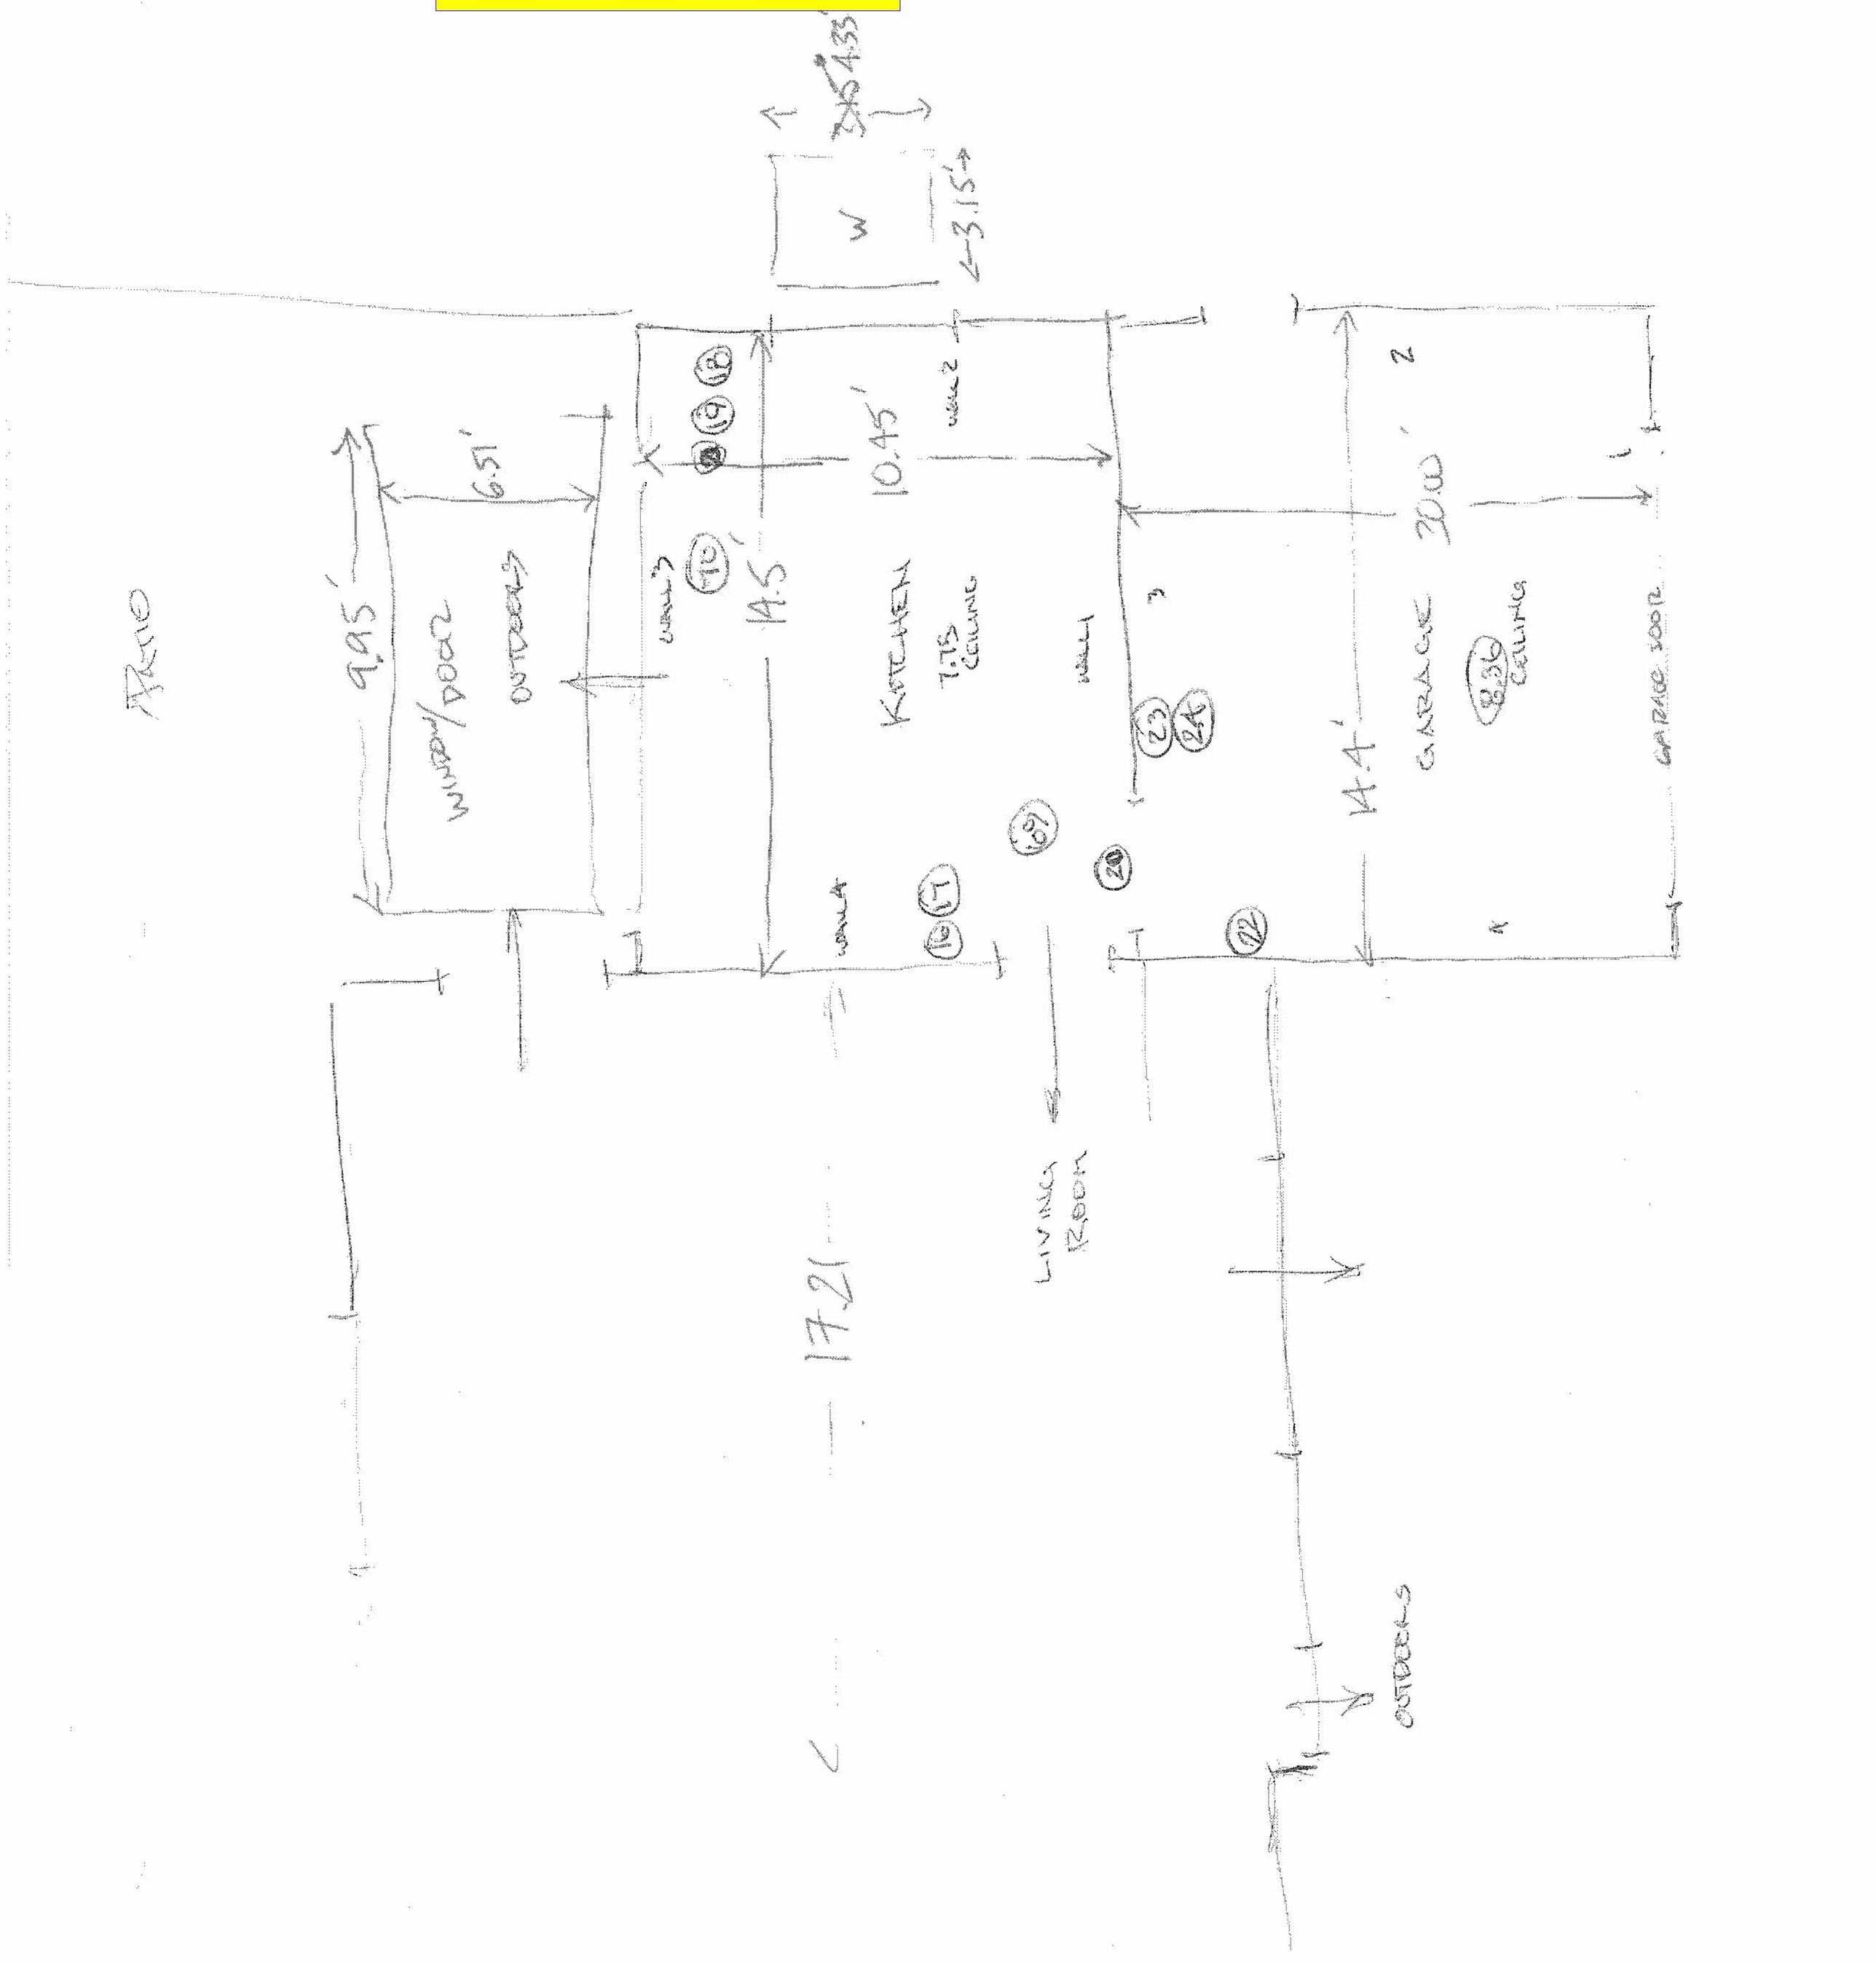

House Address _____ Page _____

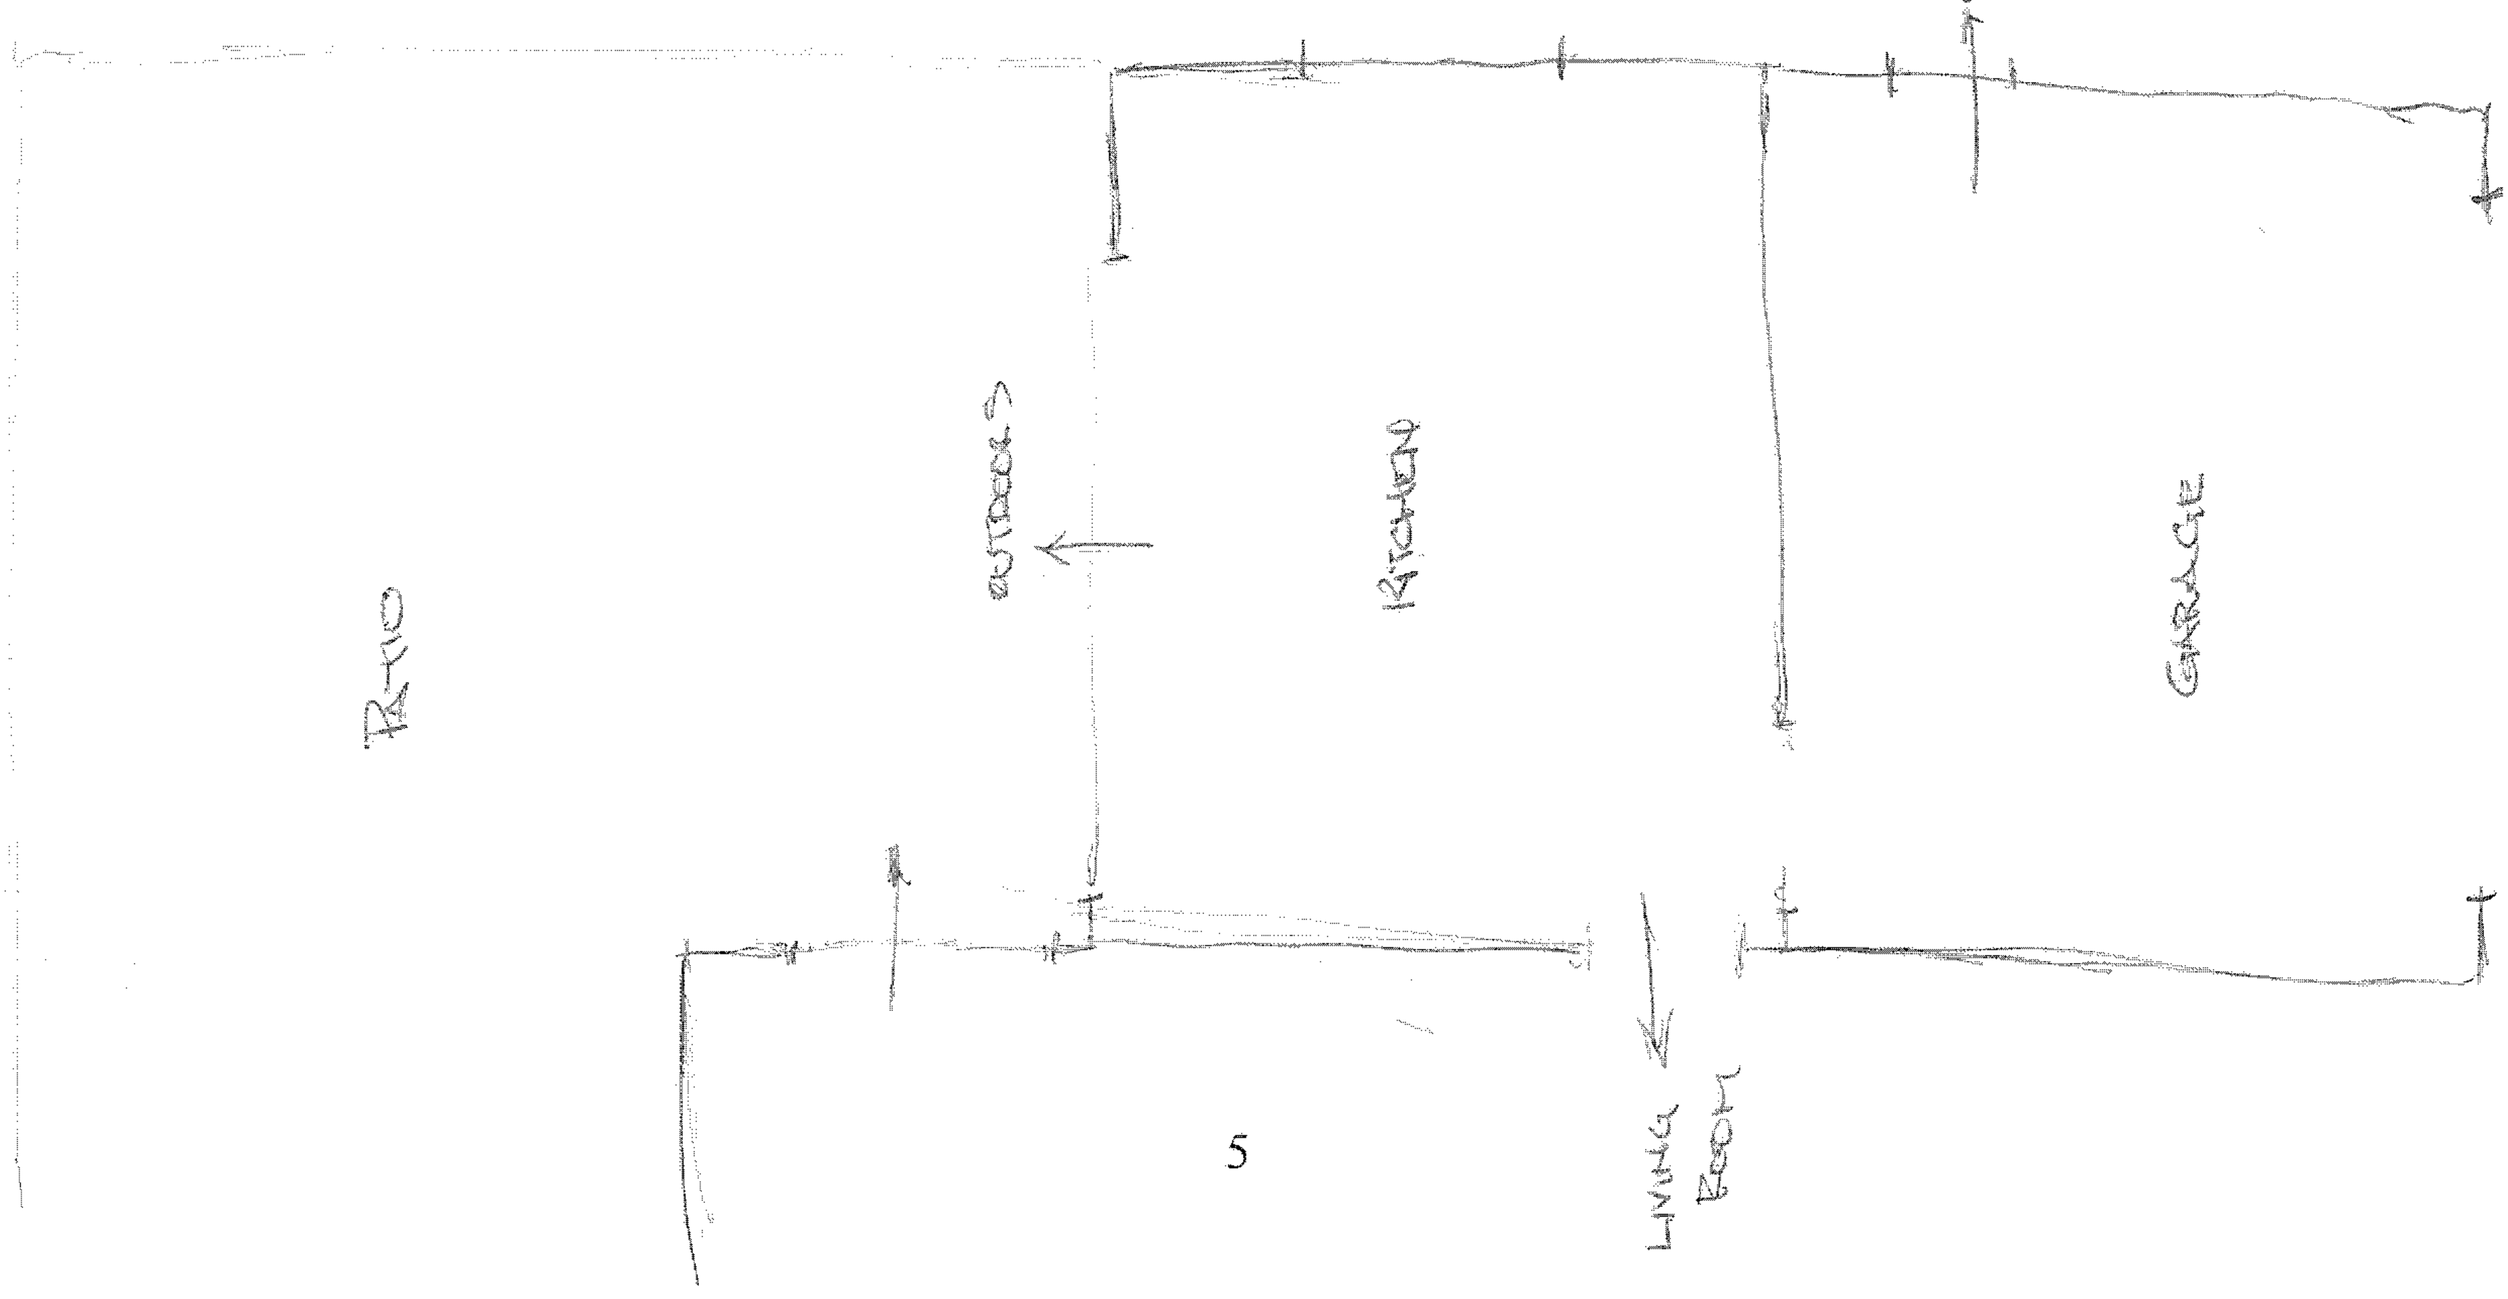

ACTIVE SAM Ξ FIELD DATA

Environmental Health & Engineering, Inc.
117 Fourth Avenue, Needham, MA 02494
TEL: (781) 247-4300
FAX: (781) 247-4305

Client: CPSC

Home Address: (b)(6)

Field Person(s): DEM TMM DSS

Date: 8/5/09
Project#: 16512

ROTA ID #: EFLMC05

SAMPLE ID	FLOOR	LOCATION	TARGET ANALYTE	SAMPLE TYPE	PUMP ID	ROTA READ START	START TIME	ROTA READ END	END TIME	SAMPLE DURATION (MINS)	NOTES
100571		Living	Organics	S	G11	.5	819	.48		200	90
100572		Duplicate		D	G09	.5		.45		200	95
100573		Outdoor		S	G13	.5		.44		201	94.47
100574		Guest		S	G15	.5		.44		202	94.94
100575		Master		S	G07	.5		.56		204	103.02
100576		FB		FB							OC
100577		MB		MB							OC

SAMPLE TYPES: S = Sample, D = Duplicate, FB = Field Blank, MB = Media Blank

ACTIVE SAM E FIELD DATA

Environmental Health & Engineering, Inc.
117 Fourth Avenue, Needham, MA 02494
TEL: (781) 247-4300
FAX: (781) 247-4305

Client: CPSC

Home Address: (b)(6)

Field Person(s): DEM TMM DSO

CMS

Date: 8/5/09

Project#: 16512

ROTA ID #: EFLMC05

SAMPLE ID	FLOOR	LOCATION	TARGET ANALYTE	SAMPLE TYPE	PUMP ID	ROTA READ START	START TIME	ROTA READ END	END TIME	SAMPLE DURATION (MINS)	NOTES
100578		Living	Inorganics	S	G08	.5	819	.51		200	101
100579		Duplicate		D	15081	.5		.42		200	91
100580		Outdoor		S	G04	.5		.39		201	89.45
100581		Craft		S	G06	.5		.50		202	101
100582		Master		S	G05	.5		.47		204	98.94
100583		FB		FB							
100584		MB		MB							

SAMPLE TYPES: S = Sample, D = Duplicate, FB = Field Blank, MB = Media Blank

ACTIVE SAM E FIELD DATA

Environmental Health & Engineering, Inc.
117 Fourth Avenue, Needham, MA 02494
TEL: (781) 247-4300
FAX: (781) 247-4305

CTS

Client: CPSC

Home Address: (b)(6)

Field Person(s): DEM TMM DSJ

Date: 8/5/09

Project#: 16512

ROTA ID #: EFLMC05

SAMPLE ID	FLOOR	LOCATION	TARGET ANALYTE	SAMPLE TYPE	PUMP ID	ROTA READ START	START TIME	ROTA READ END	END TIME	SAMPLE DURATION (MINS)	NOTES
100564		Living	ALDEHYDE	S	P02	.5	8 19	.52		201	102.51
100565		Duplicate		D	G14	.5		.48		200	98
100566		Outdoor		S	G16	.5		.41		202	91.91
100567		Guest		S	G17	.5		.48		202	98.98
100568		Master		S	G10	.5		.44		204	95.88
100569		FB		FB							
100570		MB		MB							

SAMPLE TYPES: S = Sample, D = Duplicate, FB = Field Blank, MB = Media Blank

ACTIVE SAM E FIELD DATA

Environmental Health & Engineering, Inc.
117 Fourth Avenue, Needham, MA 02494
TEL: (781) 247-4300
FAX: (781) 247-4305

Client: CPSC

Home Address: (b)(6)

Field Person(s): TMM, DEM, DSV

Date: 8/5/09

Project#: 16512

ROTA ID #: —

SAMPLE ID	FLOOR	LOCATION	TARGET ANALYTE	SAMPLE TYPE	PUMP ID	ROTA READ START	START TIME	ROTA READ END	END TIME	SAMPLE DURATION (MINS)	NOTES
100594	1	LIVING ROOM	SULFUR	S	G10		15[30]			.5 MIN	
100595	"	DUPLICATE 100594	"	D	"		15[31]				
100596	"	OUTDOORS	"	S	"		15[32]				
100597	"	GUEST ROOM	"	S	"		15[35]				
100598	"	MASTER BED	"	S	"		15[36]				

SAMPLE TYPES: S = Sample, D = Duplicate, FB = Field Blank, MB = Media Blank

HOUSE ID: 080509FL01

XRF SCAN FIELD DATA

Environmental Health & Engineering, Inc.
117 Fourth Avenue, Needham, MA 02494
TEL: (781) 247-4300
FAX: (781) 247-4305

Client: CRSC

Home Address: (b)(6)

Field Person(s): TMM, DCM, DSI

Date: 8/5/09
Project#: 16512

XRF Serial #: 10755
XRF Scan Time 20 Sec

SAMPLE ID	FLOOR	LOCATION	WALL COOR.	SAMPLE LOCATION	SURFACE TYPE	Wall ID	SAMPLE TYPE	SAMPLE SIZE	TIME	XRF Reading	NOTES
2	1	LIVING ROOM	N	6 FEET	TEXTURED	LR1	SCAN		9:16	456	
3			N	4 FEET		LR1			9:16	714	
4			E	6 FEET		LR4			9:17	839	
5			E	18"					9:17	679	SOCKET X
6			E	6 FEET					9:18	814	
7		DUPLICATE 6	E	6 FEET					9:19	742	SOCKET X
8			E	18"					9:19	760	
9			S	7 FEET		LR3			9:20	881	
10			S	18"					9:21	1022	SOCKET X
11			W	6 FEET		LR2			9:22	586	
12			W	4 FEET					9:23	918	SWITCH
13			N	6 FEET		LR1			9:27	725	
14			N S	3 FEET		LR1			9:27	1303	CLOSET
15			S	2 FEET		LR3			9:28	1550	
16		KITCHEN	E	6 FEET		K4			9:29	4067	
17			E	4 FEET		K4			9:30	3408	SWITCH X
18			S	6 FEET		K3			9:31	2948	
19			W	3 FEET		K2			9:32	2364	
20		TMM ~~DUPLICATE 19~~	~~FN~~	8 FEET					9:33	2547	

SAMPLE TYPES: S = Sample, D = Duplicate, FB = Field Blank, MB = Media Blank

XRF SCAN FIELD DATA

Environmental Health & Engineering, Inc.
117 Fourth Avenue, Needham, MA 02494
TEL: (781) 247-4300
FAX: (781) 247-4305

Client: CPSC

Home Address: (b)(6)

Field Person(s): TMM, DCM, DSJ

Date: 8/5/09
Project#: 16512

XRF Serial #: 10755
XRF Scan Time

SAMPLE ID	FLOOR	LOCATION	WALL COOR.	SAMPLE LOCATION	SURFACE TYPE	Wall ID	SAMPLE TYPE	SAMPLE SIZE	TIME	XRF Reading	NOTES
21	1	KITCHEN	W	5 FEET	TEXTURED	K2	SCAN		934	~~2547~~	2355 DUPLICATE 19
22	"	GARAGE	E	6 FEET	"	G4	1	"	938	885	
23	"	"	S	6 FEET	"	G3	"	"	939	779	
24	"	"	S	4 FEET	"	G3	"	"	940	758	SWITCH X
25	"	GUEST BED	S	6 FEET	"	[illegible]	"	"	943	645	BED3
26	"	GUEST BED	W	6 FEET	"	BED3	"	"	944	532	
27	"	"	W	2 FEET	"	BED2	"	"	945	696	
28	"	DUPLICATE 27	W	2 FEET	"	"	"	"	946	698	
29	"	"	W	2 FEET	"	"	"	"	947	1394	
30	"	"	N	6 FEET	"	BED1	"	"	950	705	
31	"	"	N	18"	"	"	"	"	951	791	SOCKET X
32	"	"	E	6 FEET	"	BED4	"	"	952	729	
33	"	"	E	18"	"	"	"	"	952	546	SOCKET X
34	"	"	S	4 FEET	"	BED3	"	"	953	716	
35	"	HALL WAY	N	3 FEET	"	HALL1	"	"	955	711	
36	"	"	E	7 FEET	"	HALL4	"	"	956	787	
37	"	"	E	2 FEET	"	"	"	"	957	861	
38	"	"	W	4 FEET	"	HALL3	"	"	959	735	
39	"	DUPLICATE 38	W	4 FEET	"	"	"	"	1000	692	

SAMPLE TYPES: S = Sample, D = Duplicate, FB = Field Blank, MB = Media Blank

XRF SCAN FIELD DATA

Environmental Health & Engineering, Inc.
117 Fourth Avenue, Needham, MA 02494
TEL: (781) 247-4300
FAX: (781) 247-4305

Client: CPSC

Home Address: (b)(6)

Field Person(s): TMM, DEM, DSJ

Date: 8/5/09
Project#: 16512

XRF Serial #: 10155
XRF Scan Time

SAMPLE ID	FLOOR	LOCATION	WALL COOR.	SAMPLE LOCATION	SURFACE TYPE	Wall ID	SAMPLE TYPE	SAMPLE SIZE	TIME	XRF Reading	NOTES
40	1	BATHROOM ~~MASTER BED~~	W	6 FEET	TEXTURED	BATH 2	SCAN		10:02	1580	
41			N	6 FEET		BATH 1			10:03	2309	
42			E	4 FEET		BATH 4			10:04	1316	
43			S	6 FEET		BATH 3			10:05	2500	
44		MASTER BED	N	6 FEET		MBED 2			10:17	319	
45			E	6 FEET		MBED 1			10:18	633	
46			E	2 FEET		MBED 4			10:19	675	
47			W	6 FEET		MBED 3			10:20	765	
48			N	4 FEET		MBED 2			10:21	396	SUBSTRATE X
49		MASTER HALL	S	3 FEET		M HALL			10:22	740	
50		CLOSET 1	N	2 FEET		MHALL C1			10:23	1407	
51		CLOSET 2	W	2 FEET		MHALL C2			10:23	1314	
52		DUPLICATE 51	W	2 FEET					10:24	1258	
53		MASTER BATH	N	6 FEET		MBATH 1			10:25	2376	
54			W	7 FEET		MBATH 2			10:26	1991	
55			S	4 FEET		MBATH 4			10:27	1645	CYLINDER
56			—	CEILING		CEILING			10:27	2499	
57		MASTER HALL	—	CEILING					10:28	1153	
58		MASTER BED	—						10:29	1033	

SAMPLE TYPES: S = Sample, D = Duplicate, FB = Field Blank, MB = Media Blank

XRF SCAN FIELD DATA

Environmental Health & Engineering, Inc.
117 Fourth Avenue, Needham, MA 02494
TEL: (781) 247-4300
FAX: (781) 247-4305

Client: CFSC

Home Address: (b)(6)

Field Person(s): THM, DEM, DSJ

Date: 8/5/09
Project#: 16512

XRF Serial #: 10755
XRF Scan Time

SAMPLE ID	FLOOR	LOCATION	WALL COOR.	SAMPLE LOCATION	SURFACE TYPE	Wall ID	SAMPLE TYPE	SAMPLE SIZE	TIME	XRF Reading	NOTES
59	1	MASTER BED	—	CEILING	TEXTURED	—	SCAN	\	10:30	793	
60	↓	BATHROOM	↓	↓	↓	↓	↓	↓	10:30	1740	
61		1							10:31	2157	
62		GUEST ROOM							10:31	1180	
63		DUPLICATE 62							10:32	1246	
64		1							10:33	1087	
65		HALLWAY			↓				10:34	397	
66		LIVING ROOM			PAINT				10:38	442	
67		↓			↓				10:39	433	
68									10:40	464	
69		KITCHEN			TEXTURED				10:41	3159	
70					↓				10:41	4172	
71		GARAGE							10:42	1176	
72		DUPLICATE 71	↓	↓	↓	↓	↓	↓	10:43	1283	
	↓										

SAMPLE TYPES: S = Sample, D = Duplicate, FB = Field Blank, MB = Media Blank

VISUAL CORROSION INSPECTION FIELD DATA

Page 1 of ____

Environmental Health & Engineering, Inc.
117 Fourth Avenue, Needham, MA 02494
TEL: (781) 247-4300
FAX: (781) 247-4305

Client: CPSC (b)(6)

Date: 8/5/09

Home Address:

Project#: 16512

Field Person(s): [redacted]/TMM/BEM

SAMPLE ID	FLOOR	LOCATION	WALL COOR.	SAMPLE LOCATION	CORROSION RATING	NOTES
PACKAGE AIR HANDLER UNIT -				ON GROUND OUTSIDE GARAGE		ON WEST SIDE of house
photos		2523 thru 2533				
		(b)(3):CPSA Section 6(b)				
ICP -		MODEL # PA9536AKAS				
		MODEL # PAPC36GA5				
		SERIAL # G02491 1592				
		DX COOLING w/ ELECTRIC STRIP HEATERS				
		dx ~~E~~ EVAPORATOR COIL LOOK NORMAL -				
		Copper is NORMAL dull color + rust occurs				
		@ ALUMINUM + COPPER TUBE INTERSECTION -				
		No UNUSUAL CORROSION NOTED - SEE PHOTO # 2526				
	1	KITCHEN SINK - COPPER FEEDS - PROBABLY TO SINK			1 -	RECENT VINTAGE photo 2523
	1	GUEST BATH SINK - COPPER FEED PIPES - ORIGINAL			1	photos 2524, 2525
	1	MASTER BATH SINK COPPER FEED PIPES - ORIGINAL			2 -	photo 2526 - 2529
	1				2	corrosion expected as
	1					house is 40 yrs old
	1	Refrigerator Compressor + Coils		coils looks excellent no	1	photos 2552 and 2553

CORROSION RATING: 0 = No Grounding Wire, 1 = No Corrosion, 2 = Some Corrosion, 3 = Heavy Corrosion

BULK

VISUAL CORROSION INSPECTION FIELD DATA

Page 1 of 1

Environmental Health & Engineering, Inc.
117 Fourth Avenue, Needham, MA 02494
TEL: (781) 247-4300
FAX: (781) 247-4305

Client: CPSC

Date: 8/5/09

Home Address: (b)(6)

Project#: 16512

Field Person(s):

SAMPLE ID	FLOOR	LOCATION	WALL COOR.	SAMPLE LOCATION	CORROSION RATING	NOTES Photo #
100585	1	Living Room	E	5 18"	1	photo # 2554
100586	1	"	E	7 6'	1	GND wire looks good - 2555
100587	1	"	S	10 18"	1	" " 2556
100588	1	Kitchen	E	17 4'	1	Hot wire looks good 2557
100589	1	Duplicate	E	17 4'	1	" " "
100590	1	Garage	S	24 4'	1	" " 2558
100591	1	Guest Bed	W	31 18"	1	GND " " 2559
100592	1	"	E	33 18"	1	GND wire good 2560
100593	1	Master Bed	W	48 4'	1	GND wire good 2561-62

CORROSION RATING: 0 = No Grounding Wire, 1 = No Corrosion, 2 = Some Corrosion, 3 = Heavy Corrosion

QTRAC

PHOTO FIELD DATA

Page ____ of ____

Environmental Health & Engineering, Inc.
117 Fourth Avenue, Needham, MA 02494
TEL: (781) 247-4300
FAX: (781) 247-4305

Client: CPSC

Home Address: (b)(6)

Field Person(s): DSJ TMM DEK

Date: 8/5/09

Project#: 16512

Camera ID: ____

PHOTO NO.	FLOOR	LOCATION	NOTES
QT 12		Living Room - QTRAC #12	Background 1150 ppm CO_2
		LOG 1 ON @ 11:41 AM	
QT 13		Guest Bdrm - QTRAC #13	Backgrow @ 1160 ppm CO_2
		LOG 1 ON @ 11:44 AM	
QT 11		Master Bedroom QTRAC #11	
		LOG 1 ON @ 11:46 AM	Bkgrow @ 1000 ppm CO_2

HOBO

~~PHOTO FIELD DATA~~

ENVIRONMENTAL HEALTH & ENGINEERING

Environmental Health & Engineering, Inc.
117 Fourth Avenue, Needham, MA 02494
TEL: (781) 247-4300
FAX: (781) 247-4305

Client: CPSC

Date: 8/5/09

(b)(6)

Home Address:

Project#: 16512

Field Person(s):

~~Camera ID:~~

~~PHOTO NO.~~ SN#	FLOOR	LOCATION	~~NOTES~~ START TIME
2412459	1	LIVING ROOM	08 55
2412449	1	MASTER BED	08 54

ID: 080509FL01

PASSIVE SAM .E FIELD DATA

Page __ of ____

Environmental Health & Engineering, Inc.
117 Fourth Avenue, Needham, MA 02494
TEL: (781) 247-4300
FAX: (781) 247-4305

Client: QSC

Date: 8/5/09

Home Address: (b)(6)

Project#: 16512

Field Person(s): TMM, DEM, DSJ

SAMPLE ID	FLOOR	LOCATION	TARGET ANALYTE	SAMPLE TYPE	START DATE	START TIME	END DATE	END TIME	NOTES
100613	1	LIVING ROOM	OZONE	S	8/5/09	1445	8/19/09	935	
100614	1	DUPLICATE		D					
100615		OUTDOORS		S					
100616		GUEST BED		S					
100617		MASTER BED		S					
100618				FB					
100619				MB					

SAMPLE TYPES: S = Sample, D = Duplicate, FB = Field Blank, MB = Media Blank

ID: 080509FL01

PASSIVE SAM .E FIELD DATA

Environmental Health & Engineering, Inc.
117 Fourth Avenue, Needham, MA 02494
TEL: (781) 247-4300
FAX: (781) 247-4305

Client: CASC

Date: 8/5/09

Home Address: (b)(6)

Project#: 16512

Field Person(s): TMM, DEM, DSJ

SAMPLE ID	FLOOR	LOCATION	TARGET ANALYTE	SAMPLE TYPE	START DATE	START TIME	END DATE	END TIME	NOTES
100599	1	LIVING ROOM	H_2S	S	8/5/09	1445	8/19/09	935	
100600	↓	DUPLICATE	↓	D	↓	↓	↓	↓	
100601	↓	OUTDOOR	↓	S	↓	↓	↓	↓	
100602	↓	GUEST BED	↓	S	↓	↓	↓	↓	
100603	↓	MASTER	↓	S	↓	↓	↓	↓	
100604	↓	↓	↓	FB	↓	↓	↓	↓	
100605	↓	↓	↓	MB	↓	↓	↓	↓	

SAMPLE TYPES: S = Sample, D = Duplicate, FB = Field Blank, MB = Media Blank

ID: 080509FL01

PASSIVE SAM .E FIELD DATA

Page __ of ____

Environmental Health & Engineering, Inc.
117 Fourth Avenue, Needham, MA 02494
TEL: (781) 247-4300
FAX: (781) 247-4305

Client: GSC

Date: 8/5/09

Home Address: (b)(6)

Project#: 16512

Field Person(s): TMM, DEM, DSJ

SAMPLE ID	FLOOR	LOCATION	TARGET ANALYTE	SAMPLE TYPE	START DATE	START TIME	END DATE	END TIME	NOTES
100606	1	LIVING ROOM	3O2	S	8/5/09	1445	8/19/09	935	
100607	1	DUPLICATE		D					
100608	G	OUTDOORS		S					
100609	1	GUEST ROOM		S					
100610	1	MASTER BED		S					
100611				FB					
100612				MB					

SAMPLE TYPES: S = Sample, D = Duplicate, FB = Field Blank, MB = Media Blank

ID: 080509FL01

PASSIVE SAM .E FIELD DATA

Page __ of ____

Environmental Health & Engineering, Inc.
117 Fourth Avenue, Needham, MA 02494
TEL: (781) 247-4300
FAX: (781) 247-4305

Client: GSC

Date: 8/5/09

Home Address: (b)(6)

Project#: 1651Z

Field Person(s): TMH, DEM, DSJ

SAMPLE ID	FLOOR	LOCATION	TARGET ANALYTE	SAMPLE TYPE	START DATE	START TIME	END DATE	END TIME	NOTES
100620	1	LIVING ROOM	ALDEHYDE	S	8/5/09	14 45	8/9/09	9 35	
100621	1	DUPLICATE		D					
100622	G	OUTDOORS		S					
100623	1	GUEST BED		S					
100624	1	MASTER BED		S					
100625				FB					
100626				MB					

SAMPLE TYPES: S = Sample, D = Duplicate, FB = Field Blank, MB = Media Blank

ID:
08050 FL01

PASSIVE SAM .E FIELD DATA

Page __ of ____

Environmental Health & Engineering, Inc.
117 Fourth Avenue, Needham, MA 02494
TEL: (781) 247-4300
FAX: (781) 247-4305

Client: CRSC

Date: 8/5/09

Home Address: (b)(6)

Project#: 16512

Field Person(s): TMM, DEM, DSJ

9:15 13 18:50

SAMPLE ID	FLOOR	LOCATION	TARGET ANALYTE	SAMPLE TYPE	START DATE	START TIME	END DATE	END TIME	NOTES
100627	1	LIVING ROOM	COUFEN	S	8/5/09	1445	8/6/09	935	
100628	1	DUPLICATE	"	D	"	"	"	"	
100629	G	OUTDOORS	"	S	"	"	"	"	
100630	1	MASTER	"	S	"	"	"	"	
100631	-	-	-	FB	-	-	-	-	

SAMPLE TYPES: S = Sample, D = Duplicate, FB = Field Blank, MB = Media Blank

PHOTO FIELD DATA

Environmental Health & Engineering, Inc.
117 Fourth Avenue, Needham, MA 02494
TEL: (781) 247-4300
FAX: (781) 247-4305

Client: CPSC

Date: 8/5/09

Home Address: (b)(6)

Project#: 16312

Field Person(s): TMM DEM BSJ

Camera ID: _____

PHOTO NO.	FLOOR	LOCATION	NOTES
2517		STREET #	
2518		FRONT OF HOUSE	
2519		EAST SIDE	
2520		EAST / SOUTH CORNER	
2521		SOUTH SIDE - BACK	
2522		WEST SIDE	
2523 - 2533		- SEE AHU.	
2534		KITCHEN	
2535		LIVING ROOM	
2536		GARAGE	
2537		OUTDOOR PORCH + LANAI	
2538		GUEST BDROOM	
2539		MASTER BDRM	
2540		"	
2541		GUEST BATH	
2542		FRONT HALL	
2543 - 2553		PLUMBING SHOTS - SEE CORROSION LOG	
2554 2565 -		ELECTRICAL ASSET SHOTS - SEE BULK DATA SHEET	