


# PURAFIL ENVIRONMENTAL CORROSION REPORT

Company: 118608

17-Nov-2010

Sales Order #: C002726  
 CCC Panel #: P68792  
 Date In: 19-Oct-2010  
 Date Out: 01-Nov-2010  
 Days In Service: 13

Room/Area ID:  
 Reference #:

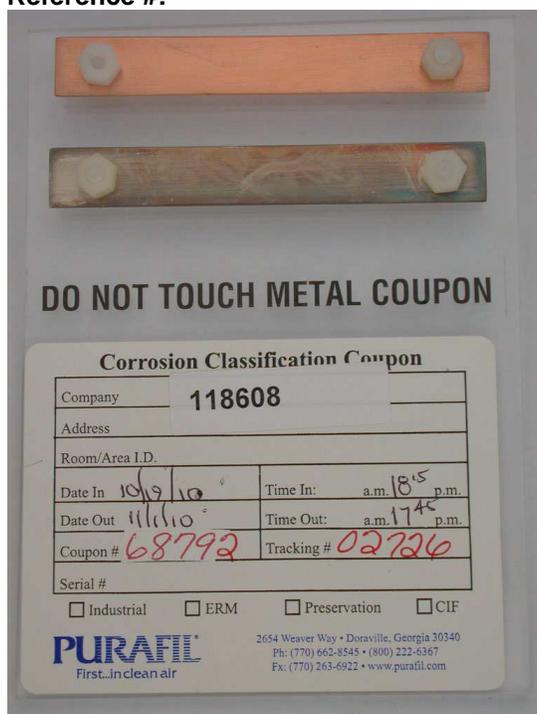

**DO NOT TOUCH METAL COUPON**

Corrosion Classification Coupon	
Company	118608
Address	
Room/Area I.D.	
Date In	10/19/10
Time In:	a.m. 10 <sup>15</sup> p.m.
Date Out	11/1/10
Time Out:	a.m. 17 <sup>45</sup> p.m.
Coupon #	68792
Tracking #	02726
Serial #	
<input type="checkbox"/> Industrial <input type="checkbox"/> ERM <input type="checkbox"/> Preservation <input type="checkbox"/> CIF	
<b>PURAFIL</b> First...in clean air	
<small>2654 Weaver Way • Doraville, Georgia 30340            Ph: (770) 662-8545 • (800) 222-6367            Fx: (770) 263-6922 • www.purafil.com</small>	

**CCC Panel # P68792**

**ISA Class G2**  
Moderate

**Copper Corrosion**  
394 Å/30 Days

**Silver Corrosion**  
971 Å/30 Days

(see next page for complete analysis)

### Summary for PURAFIL CCC # P68792

The electrolytic reduction analysis on Corrosion Classification Coupon #P68792 shows the presence of moderate concentrations of contaminants in the environment tested. The hydrogen sulfide level is expected to range between 3 and 10 ppb and the sulfur dioxide level between 10 and 100 ppb. The effects of corrosion are measurable and may be a factor in determining equipment reliability.

Your local representative for additional information and assistance is:  
 Environmental Health and Eng  
 117 Fourth Avenue, Needham MA 02494, USA  
 tminegishi@eheinc.com

---

Purafil, Inc. / 2654 Weaver Way, Doraville GA 30340 USA / (770) 662-8545 / (770) 263-6922  
 Email: purafil@purafil.com / Internet: http://www.purafil.com

---

Displaying Page 1    [Display Page 2](#)

**PURAFIL CCC # P68792 Analysis Results**

<b>Corrosion Film Composition</b>				<b>Gold Coupon - Magnified 20x</b>
	Projections			
	30 Days	1 Year	5 Year	
<b>Copper Films</b>				
Cu <sub>2</sub> S	286 Å	378 Å	494 Å	
Cu <sub>2</sub> O	108 Å	142 Å	186 Å	
Unknowns	0 Å	0 Å	0 Å	
Totals	394 Å	520 Å	680 Å	
<b>Silver Films</b>				
AgCl	0 Å	0 Å	0 Å	
Ag <sub>2</sub> S	971 Å	11826 Å	59129 Å	
Unknowns	0 Å	0 Å	0 Å	
Totals	971 Å	11826 Å	59129 Å	
<b>Gold Pore Corrosion:</b>				
Note: 1000 Å = 0.1 micron				

**Equipment Reliability Correlation**  
(ISA Standard S71.04-1985 for Copper)

